


ClearPlex® WOODWORKER

37" WOODLATHE Model No. CWL12D

Part No. 6500680

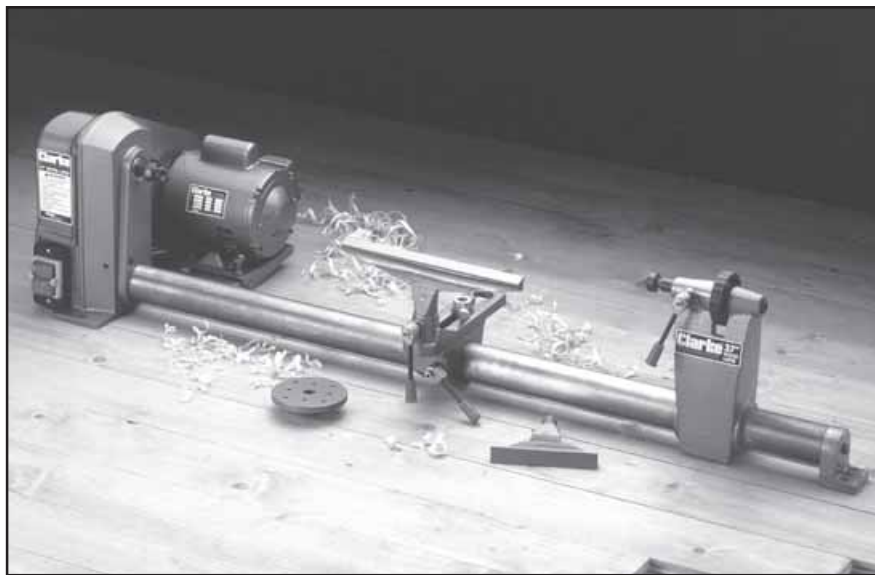

OPERATING & MAINTENANCE INSTRUCTIONS

CONTENTS**PAGE**

Lathe Specifications	3
General Safety Instructions	5
Wood Lathe Safety Instructions	6
Electrical Connections and Motor Specifications	7
Unpacking And Checking Contents	8
Assembly And Installation	9
Understanding your Lathe	11
Spindle Speeds and Belt Tensioning	12
Preparation for use (Spindle/Faceplate/Outboard Turning & Indexing)	13
Using Woodworking Chisels and Basic Techniques	18
Making Standard Cuts	23
Spindle Turnings	26
Miscellaneous Operations	28
Face Plate And Chuck Turnings	29
Fancy Face Plate Turnings	30
Turning Plastics	33
Sanding, Buffing And Polishing	34
Maintenance	35
Lubrication	35
Optional Accessories	36
Spares And Servicing	36
Parts List	37
Parts Diagram	38

Thank you for purchasing this CLARKE 37" Wood lathe, designed for DIY and semi professional use. Before assembling this machine, please read this manual thoroughly and follow all instructions carefully. In doing so you will ensure the safety of yourself and that of others around you, and you can

GUARANTEE

This CLARKE product is guaranteed against faulty manufacture for a period of 12 months from the date of purchase. Please keep your receipt as it will be required as proof of purchase. This guarantee is invalid if the product is found to have been abused or tampered with in any way, or not used for the purpose for which it was intended.

Faulty goods should be returned to their place of purchase, no product can be returned to us without

WARNING:
THIS MACHINE MUST NOT BE MODIFIED, OR USED FOR ANY PURPOSE

SPECIFICATIONS

Motor	230V 50Hz 1Ph
	Power Rating 370W
	Switch Type No Volt Release
Turning Capacity	(Between Centres) 37 in (940mm)
	(Over Bed) 12 in Dia (305mm)
Spindle Speeds	1. 475 RPM
	2. 838 RPM
	3. 1374 RPM
	4. 2215 RPM
	5. 3260 RPM
Headstock Drive Spindle	Inboard a. No. 1 Morse Taper
 b. External 3/4 UNF thread
	Outboard External 3/4 UNF Left Hand thread
Tailstock Spindle	No. 1 Morse Taper
Tailstock Spindle Advance	2 ³ / ₈ in (60mm) via hand wheel)
Overall Dimensions (LxWxH)	54 ¹ / ₈ x 15 ³ / ₄ x 12 ¹ / ₈ in (1,375x400x308 mm)

GENERAL SAFETY RULES FOR OPERATING MACHINERY

WARNING

As with all machinery, there are certain hazards involved with their operation and use. Exercising respect and caution will considerably lessen the risk of personal injury. However, if normal safety

1. **KNOW YOUR MACHINE.**
Read the manual carefully. Learn the machines applications and limitations, as well as the specific potential hazards peculiar to it.
2. **KEEP GUARDS IN PLACE**
and in working order.
3. **EARTH ALL MACHINES.**
If the machine is equipped with three-pin plug, it should be plugged into a three-pin electrical socket. Never remove the earth pin.
4. **REMOVE ADJUSTING KEYS AND WRENCHES.**
5. **KEEP WORK AREA CLEAN.**
Cluttered areas and benches invite accidents.
6. **DON'T USE IN DANGEROUS ENVIRONMENT.**
Don't use machinery in damp or wet locations, or expose them to rain. Keep work area well lit.
7. **KEEP CHILDREN AND VISITORS AWAY.**
All children and visitors should be kept a safe distance from work area.
8. **MAKE WORKSHOP CHILDPROOF**
Use padlocks, master switches or remove starter keys etc.
9. **DON'T FORCE THE MACHINE.**
It will do the job better and safer, at the rate for which it was designed.
10. **USE RIGHT TOOL.**
Don't force a tool or attachment to do a job for which it was not designed.
11. **WEAR PROPER APPAREL.**
Loose clothing, gloves, neckties, rings, bracelets, or other jewellery may get caught in moving parts. Nonslip footwear is recommended. Long hair should be contained.
12. **USE SAFETY GLASSES.**
Also use face or dust mask if cutting operation is dusty. Everyday eyeglasses only have impact resistant lenses, they are NOT safety glasses.
13. **USE EAR DEFENDERS.**
14. **DON'T OVERREACH.**
Keep proper footing and balance at all times.
15. **MAINTAIN TOOLS IN TOP CONDITION.**
Keep tools sharp and clean for best and safest performance. Follow instructions for lubricating and changing accessories.
16. **ALWAYS DISCONNECT THE MACHINE**
before servicing or changing accessories.
17. **AVOID ACCIDENTAL STARTING.**
Ensure the machine is switched OFF before plugging in.
18. **CHECK FOR DAMAGE.**
If part of the machine (eg. A cover or guard), is damaged, it should be carefully inspected to ensure that it can perform its' intended function correctly. If in doubt, the part should be renewed. Damage to moving parts or major components should be Inspected by a qualified technician before operating the machine. Contact your local dealer for advice.
19. **DO NOT STAND ON THE MACHINE.**
Serious injury could occur if the machine is tipped over. Do not store materials above or near the machine such that it is necessary to stand on the machine to get to them.
20. **NEVER operate a machine when under the**

ADDITIONAL SAFETY RULES FOR WOOD LATHES

1. **IMPORTANT:** You should not operate this machine unless you are thoroughly familiar with wood turning lathes and wood turning techniques. If there is any doubt whatsoever, you should consult a qualified person.
2. Do not operate the machine until it is completely assembled, and this entire manual, has been read and understood.
3. Ensure the proper electrical regulations are followed. The machine must be properly earthed.
4. Before switching the machine ON, **ALWAYS:-**
 - a. Clear the lathe bed of ALL objects (tools, scraps of wood etc.).
 - b. Examine the setup carefully, ensuring nothing could possibly interfere with the rotating workpiece. eg. The tool rest is secure and not liable to swing into the workpiece. Rotate workpiece by hand to check.
 - c. Ensure the tool rest is adjusted to the correct height, and is as close to the workpiece as possible.
 - d. Ensure all clamps are properly secured.
 - e. Ensure your clothing is properly adjusted.
 - f. Ensure the workpiece is centralised.
5. Make all adjustments with the power OFF.
6. **ALWAYS** use the slowest speed when starting a new workpiece, and cut at correct speed for material and shape.
7. **ALWAYS** remove the tool rest when sanding or polishing.
8. When turning between centres, always ensure that the tailstock centre is snug against the workpiece, with the spindle locked, AND the Tailstock securely locked to the bed. NEVER loosen the tailstock spindle OR the tailstock with the workpiece turning.
NOTE: The centre should be lubricated (unless it is a ball bearing type).
9. **DO NOT** drive the workpiece into the centre when the centre is installed in the headstock. Always set the workpiece into the centre with a soft mallet first, and then mount the Centre with workpiece attached into headstock spindle.
10. When using the Faceplate, ensure the workpiece is securely fastened to it and the appropriate size faceplate is used to correctly support the workpiece. Ensure the securing screws cannot interfere with the turning tool at the finished dimension.
11. **ALWAYS** rough cut the workpiece as close as possible to the finished shape before mounting on to a faceplate.
12. **ALWAYS** examine the workpiece for flaws. Do not use wood which is split or has knots. Test glued joints before mounting on to lathe to ensure they have completely set.
13. When roughing off, **DO NOT** jam tool into workpiece or take too big a cut.
14. **NEVER** attempt to remount a faceplate turning to the faceplate for any reason. Never attempt to remount a between-centres turning if the original centres in the turning have been altered or removed.
15. **ALWAYS** clean the machine at the end of a working session. Remove centres from the headstock AND tailstock and store them. Ensure the work area is cleaned before leaving the machine.
16. Should any part of the lathe be missing, damaged, or fail in any way, or any electrical component fail to perform properly, shut OFF the machine and disconnect from the power supply. Replace missing, damaged or failed parts before resuming operation. If in doubt, consult your local dealer. Always disconnect from power supply when carrying our repairs.
17. Be particularly careful with your clothing when operating a lathe. Always wear safety glasses. Long hair should be contained. See General Safety Instructions - Apparel.
18. Do not exceed recommended speeds. Refer to chart on page 12

ELECTRICAL CONNECTIONS

Connect the mains lead to a standard 230 volt (50Hz) electrical supply using a 13 amp BS1363 plug fitted with a 13 amp fuse. or a suitably fused isolator switch.

WARNING : THIS APPLIANCE MUST BE EARTHED.

IMPORTANT : The wires in the mains lead are coloured in accordance with the following code :

Green & Yellow	-	Earth
Blue	-	Neutral
Brown	-	Live

As the colours of the flexible cord of this appliance may not correspond with the coloured markings identifying terminals in your plug, proceed as follows :-

Connect GREEN & YELLOW coloured cord to plug terminal marked with a letter "E" or Earth symbol '⏏' or coloured GREEN or GREEN & YELLOW.

Connect BROWN coloured cord to plug terminal marked letter "L" or coloured RED.

Connect BLUE coloured cord to plug terminal marked letter "N" or coloured BLACK.

We recommend that this unit is fitted with a Residual Current Device (RCD)

FUSE RATING

The fuse for the plug in this appliance must be rated at **13 amps**.

MOTOR SPECIFICATIONS

The five speed pulley system of this lathe is designed to use a 1725 RPM, 370W motor. Rotation is clockwise as viewed from the pulley end of the shaft. It is wired for 230 Volt, 50Hz.

Caution: Do not any other type of motor as their use may be hazardous.

The machines' ON and OFF buttons are marked "I" for ON and "O" for OFF.


Should the power fail whilst the machine is in use, the NO VOLT RELAY will operate. This is a safety feature which prevents the machine from starting up automatically when the power is restored. It

UNPACKING AND CHECKING CONTENTS OF CARTON

Your wood lathe is shipped complete in one carton.

Separate all parts from packing materials and check against the lists below to ensure that all items are accounted for, before discarding any packing material.

If any parts are missing or damaged in any way, please contact your Clarke dealer immediately.

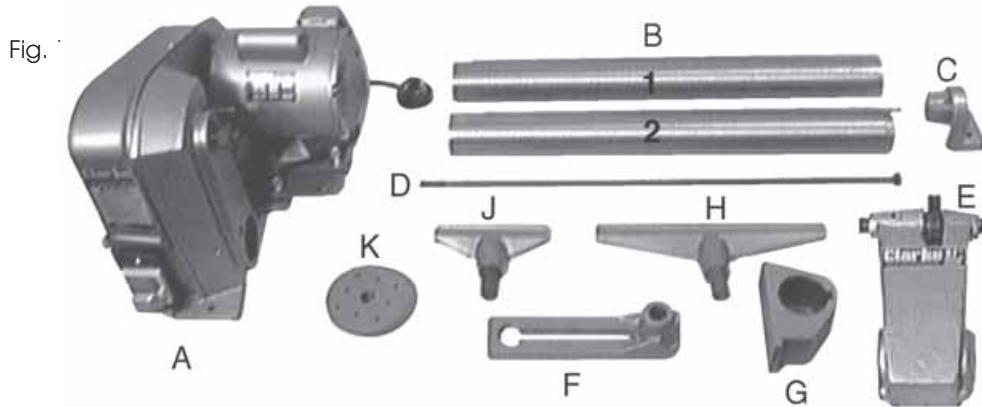

A. Head stock assembly.

Includes : Drive spindle, motor, drive belt, pulleys (2), pulley guard, spindle nut, ON-OFF switch , power cable, and outboard spindle cover.

B. Bed. (1- Headstock End, 2 - Foot End)

C. Foot

D. Bed Clamping bolt

E. Tailstock assembly

F. Tool rest bracket

G. Tool rest base


H. Tool rest -12"

J. Tool rest - 6"

K. Faceplate - 4"

Also included but not shown - one bag containing loose parts and tools, listed below.

TABLE OF LOOSE PARTS

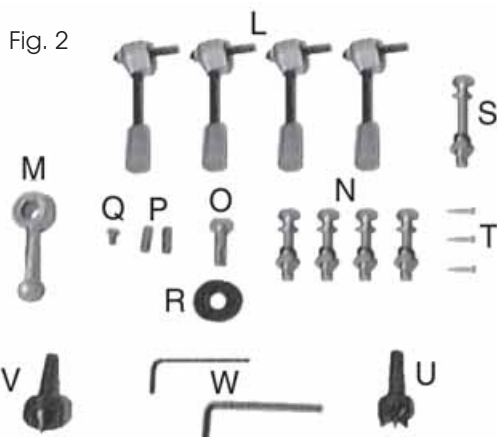

L. Locking handle assemblies (4 pcs)

M. Tool rest locking handle

N. Mounting bolts c/w nuts and washers (4pcs)

O. Tool rest bracket securing bolt

P. Brass slugs (2 pcs)

Q. Screw (countersunk head)

R. Flat washer

S. 3 1/2" Bolt c/w nut and washers

T. 1/2" Pan head wood screws (3 pcs)

U. Spur Centre

V. Revolving Centre

W. Hex. wrenches (2 pcs)

ASSEMBLY AND INSTALLATION


Ref. Figs. 1 & 2

1. MOUNTING HEADSTOCK TO BENCH

- 1.1 Drill two 10mm holes in your bench or stand according to diagram, Fig. 3.

Note: Make sure the top of your bench is positioned so that you don't drill into the legs or rail underneath.

- 1.2 Position the headstock assembly (A) on the bench and insert two 5/16" x 2" carriage bolts through the two mounting holes in the base. Place a flat washer, a lock washer and a nut from the underside on each bolt. Tighten nuts - only finger tight at this time.

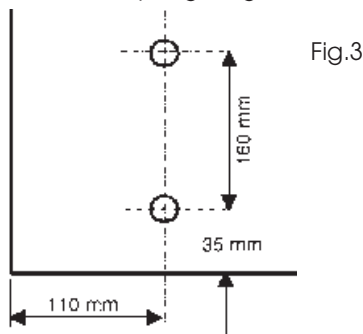

2. ASSEMBLY OF LATHE BED HALVES.

- 2.1 Assemble the two bed halves (steel tubes) together by inserting the Headstock end (the tube with the plugged end carrying the threaded hole in the centre of the plug), into the machined inside diameter of the Tailstock end.

- 2.2 Insert the 'V' shaped portion of the foot (C), into the open, exposed Tailstock end and then insert the bed clamping bolt (D) through the foot and into the threaded hole in the plugged headstock end. Start the thread but do not tighten at this time.

NOTE: It may assist by turning the complete bed assembly on its end to locate the long bolt into the threaded hole in the end of the headstock bed end.

- 2.3 Align the two keys (the strips of metal attached to each bed half with screws) so that they line up exactly. This alignment is necessary so that the Tail Stock Assembly (E), and the Tool Rest Base (G), will slide freely over the joint formed by the two halves of the bed.

To carry out this alignment, first align the two keys by eye as close as possible. Next, using a metal straight edge against one side of the keys, slide the end of the straight edge across the joint first from one side of the joint and then from the opposite side. If there is a "click" or a hang-up of the straight edge at the joint, it will be obvious what relative direction the two halves of the bed will have to be rotated to achieve alignment.

Repeat this process as many times as necessary, on both sides of the key, to be satisfied the alignment has been attained.

When satisfied, screw in the single countersunk headed screw (Q), through the hole in the key and into the tailstock end so that the two halves of the bed are now secured.

- 2.4 Nip up the Bed clamping bolt (but do not fully tighten), so that when the foot is placed on the bench, the key is facing downwards.

3. ASSEMBLY OF BED TO HEADSTOCK

- 3.1 Slide the tail stock assembly (E), and the tool rest base assembly (G), on to the bed as shown in Fig. 10.

Ensure the Clarke label on the Tailstock and the threaded hole in the tool rest base (shown in fig 4), faces towards the front.

Fig.4



- 3.2 Now insert the bed assembly into the headstock assembly (A), fully, and manoeuvre the lathe so that the bed is parallel to the front edge of the bench.

4. SECURING THE LATHE TO THE BENCH

- 4.1 Mark the position of the two Foot mounting holes and drill two 10mm holes in the bench.
- 4.2 Insert the Foot mounting bolts, and shake the complete assembly to ensure it is stable and lying flat on the bench. When satisfied, nip up all four mountings - **finger tight only**. REMEMBER At this stage the bed clamping bolt must not be tight.

If the bed is too loose however, the weight of the Tailstock and Tool rest base may cause the bed to rotate. In this event, nip up the Bed Securing Set Screw (T, fig 10).

- 4.3 For additional rigidity of the motor and it's mounting brackets, a 8mm hole must be drilled through the bench top using the hole in the hinge bracket (V, fig 10), as a pilot. It will be necessary to remove the four mounting bolts and moving the headstock slightly to facilitate the drilling of the hole.

Locate 1/4" x 3 1/2" long hex. head bolt in the bag of loose parts together with 2 plain flat washers, a spring lock washer and a nut. Place a plain flat washer on to the bolt and insert the bolt through the hinge bracket hole and on through the bench top. From the underside of the bench, place a plain flat washer, the spring lock washer and then the nut, on to the bolt. Do not tighten fully.

- 4.4 Next, secure the belt guard to the bench with wood screws. Open the blade guard cover to reveal three holes in the bottom flange of the plate. Locate three 1/2 inch long pan head wood screws in the bag of loose parts. Ensure the plate is parallel to the belt and the cover opens and closes easily then screw in the wood screws loosely.
- 4.5 Gently shake the complete assembly to ensure it is stable and lying flat on the bench, and when satisfied, tighten the four mounting bolts followed by the motor bracket securing bolt and the three wood screws, fully.


5. COMPLETING THE ASSEMBLY

The 4 locking handles are used to lock the Tailstock and the Tool Rest base to the bed, the Tool Rest to its bracket, and to lock the Tailstock spindle to prevent it from moving during operation.

Before screwing the handles in place, ensure that a brass slug is inserted in each of the holes where the Tailstock and the Tool Rest base are secured to the bed. i.e. the threaded hole shown in the tool rest base in Fig. 4, and the tailstock locking handle hole. (see fig. 6).

Finally, place the tool rest bracket on top of the tool rest base and screw the bolt with flat washer and wrench (as arranged in fig 5), through the slot in the bracket and into one of the holes in the base.

Fig. 5

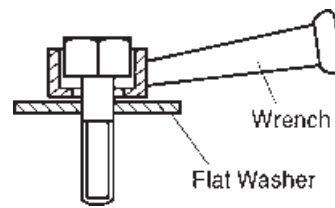

The wrench provides a quick release type of attachment, so that the tool rest can be moved quickly to a new position. eg. As the diameter of the workpiece decreases, the tool rest must be moved to maintain an acceptable clearance between it and the work. (This adjustment MUST be carried out with the machine switched OFF)

6. ADJUSTING THE TAIL STOCK TO THE BED

The tailstock supports the workpiece for spindle turning, that is, turning between centres.


To prevent it from rocking during operation a screw is provided at its base (see fig. 6), which bears against the keyway on the underside of the bed, thereby reducing the play between the key and the tailstock keyway.

To carry out this adjustment, proceed as follows Tighten down the adjusting screw moderately against the keyway, then slacken off about 1/4 turn.

Slide the tailstock along the full length of the bed. If it binds or sticks in any one spot, loosen the adjusting screw only enough so that the tail stock slides smoothly. If the tail stock feels loose and can be rocked slightly, tighten the screw only enough so that it will not bind when sliding the full length of the bed.

When both conditions have been met, tighten the lock nut.

Fig. 6

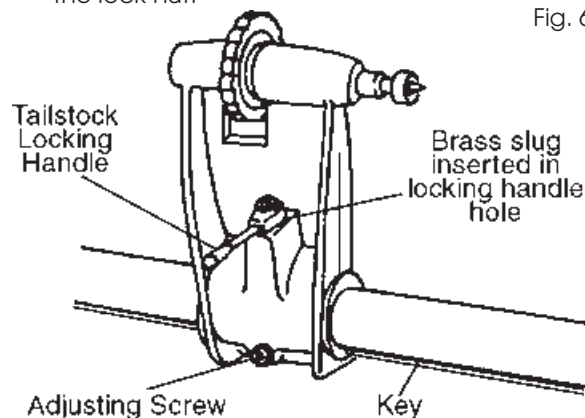


5. ALIGNING THE CENTRES

- 5.1 The spur centre and the revolving centre are used for spindle turning and should always be in alignment. To align centres refer to Fig. 7 and adjust as follows:
- 5.2 Insert spur centre into head stock spindle and revolving centre into tailstock spindle.

Note: Do not drive or hammer centres into their spindle's as it is completely unnecessary, and removal may be difficult. Simply tap them home with a piece of wood.

Fig. 7

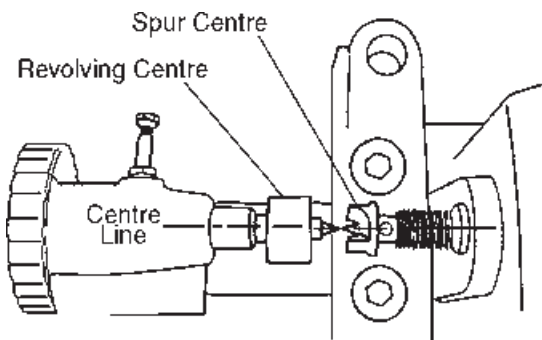

Slide the tailstock toward the headstock so that the two points of the centres are very close but not touching. Tighten the tailstock lock.

Loosen the bed clamping bolt (D), in the foot, about two turns.

Using a 3/16 hex wrench (supplied), loosen the bed securing set screw, located on the back of the head stock (T, fig. 10).

Swing the tailstock so that the points of the Centres coincide perfectly, then tighten the bed securing set screw and the bed clamping bolt (D), firmly.

6. REMOVAL OF SPUR CENTRE FROM SPINDLE

To remove the spur centre from spindle, hold the spindle pulley with one hand whilst turning the spindle nut on the threaded portion of the spindle, with a spanner, anticlockwise until the centre is ejected.


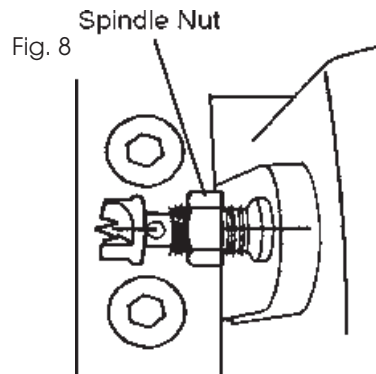


Fig. 8

7. REMOVAL OF REVOLVING CENTRE

To remove revolving centre from tail stock spindle, insert a 6mm dia. rod through the hole in the tailstock spindle. Hold the centre with one hand and tap the rod with a hammer.

Fig. 9

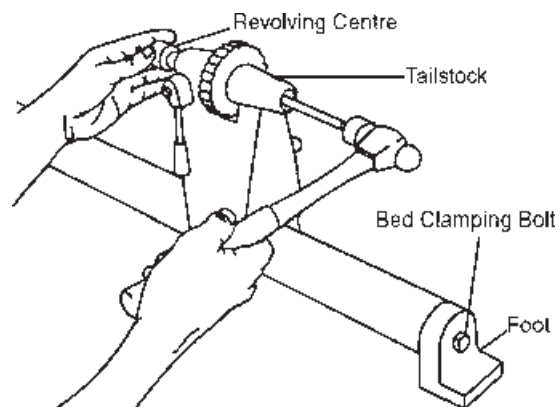

UNDERSTANDING YOUR LATHE

LATHE PARTS, CONTROLS, NOMENCLATURE AND FUNCTIONS

Become familiar with the nomenclature and purpose of the various operating controls and parts of your lathe. Please read and fully understand this manual before attempting to perform any operation.

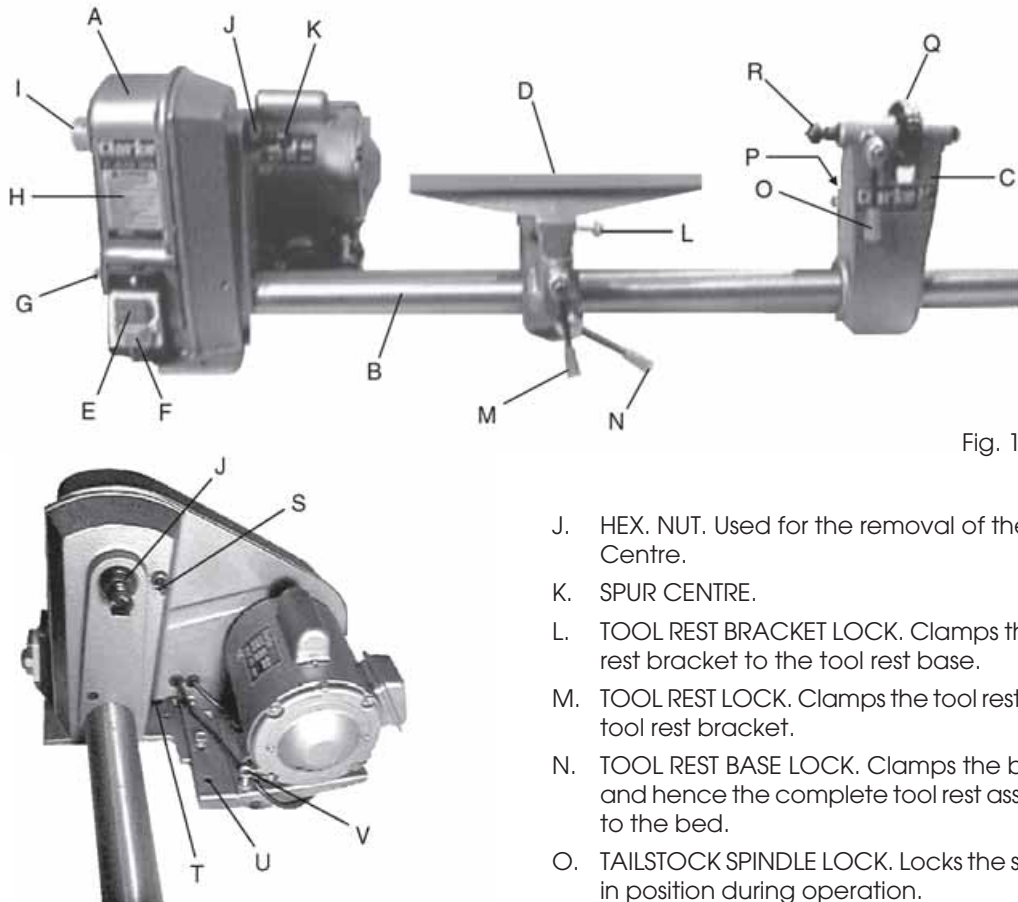



Fig. 10

- A. HEADSTOCK
- B. BED
- C. TAILSTOCK
- D. TOOL REST
- E. ON BUTTON (I)
- F. OFF BUTTON (O)
- G. BELT GUARD LOCK. Ensures the cover is locked during operation
- H. WARNING LABEL. Essential instructions which should be complied with.
- I. OUTBOARD SPINDLE END COVER. Protects the operator from rotating outboard end of the spindle when not being used for outboard turning.

- J. HEX. NUT. Used for the removal of the Spur Centre.
- K. SPUR CENTRE.
- L. TOOL REST BRACKET LOCK. Clamps the tool rest bracket to the tool rest base.
- M. TOOL REST LOCK. Clamps the tool rest to the tool rest bracket.
- N. TOOL REST BASE LOCK. Clamps the base and hence the complete tool rest assembly to the bed.
- O. TAILSTOCK SPINDLE LOCK. Locks the spindle in position during operation.
- P. TAILSTOCK LOCK. Clamps the tailstock to the bed.
- Q. HAND WHEEL. Adjusts the tailstock spindle.
- R. ROTATING CENTRE.
- S. INDEX PIN. Engages with the spindle pulley to produce equal spacing for various operations such as fluting, reeding or for dividing face plate work. DO NOT use to remove the Centre. This pin MUST be DISENGAGED for normal operations.
- T. BED LOCKING SCREW. Hex socket head screw.
- U. MOTOR BRACKET MOUNTING HOLE.
- V. DRIVE BELT ADJUSTER.

SPINDLE SPEEDS

A chart showing spindle speeds and recommended turning speeds is mounted on the pulley cover, and for convenience, is duplicated as follows:

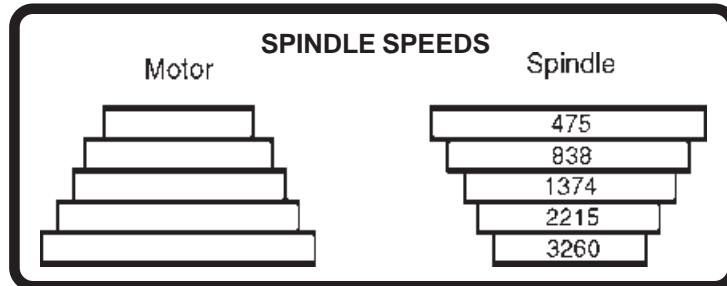

RECOMMENDED GENERAL SPEEDS

SPINDLE TURNING

SQUARE	LENGTH
1" (25mm)	12" (305mm)
2" (50mm)	18" (455mm)
3" (75mm)	24" (610mm)
4" (100mm)	30" (760mm)
5" (125mm)	36" (915mm)

ROUGHING	FINISHING
1374	3260
838	2215
838	2215
475	2215
475	2215

FACE PLATE TURNING

DIAMETER	THICKNESS
12" (305mm)	4" (100mm)Max.
10" (255mm)	4" (100mm)Max.
8" (205mm)	4" (100mm)Max.
6" (150mm)	4" (100mm)Max.

ROUGHING	FINISHING
475	1374
838	2215
1374	2215
2215	3260

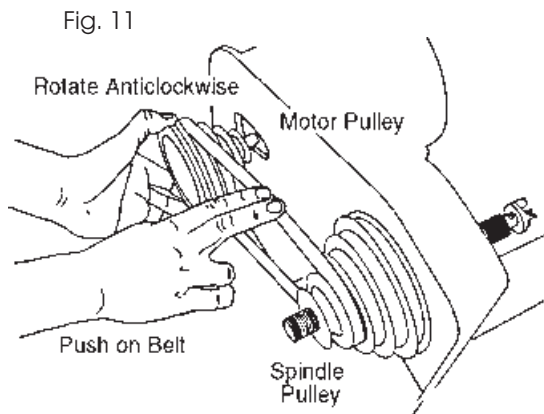


Fig.11 shows the belt positioned on the second step from the outside edge of the pulley. This produces a spindle speed of 2215 RPM. (Refer to the chart above).

If you wish to run at a slower speed, say 1374 RPM, you must shift the belt inwards, 1 step.

CAUTION : MAKE SURE THE POWER CORD IS REMOVED FROM THE OUTLET BEFORE ATTEMPTING TO CHANGE THE BELT POSITION.

BELT TENSION ADJUSTMENT

Belt tension is provided by the weight of the motor pivoting the motor mounting bracket downward through the "hinge" of the hinge bracket. To increase the belt tension, screw in the adjustment bolt located in the corner of the motor mounting bracket (V, fig. 10), thus restricting downward pivoting travel. Conversely, loosening the adjusting bolt allows increased pivot on the bracket thus decreasing belt tension.


PREPARATION

1. SPINDLE TURNING

If you are not experienced at the art of wood turning, we suggest that you practice using the various wood turning tools, starting with turning a small spindle.

- 1.1 Select a piece of wood 50x50x305mm.


Fig. 12

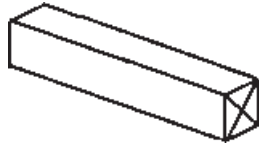

- 1.2 Draw diagonal lines on each end to locate the centres.
- 1.3 On one end, make a saw cut approximately 2mm deep on each diagonal line. This is for the spur centre.
- 1.4 The other end is the rotating centre. Place the point of the centre on the wood where the diagonal lines cross.
- 1.5 Drive the centre into the wood. Use a wooden mallet or a plastic hammer, but put a piece of wood on the end of the centre to protect it.

Fig. 13

Wooden Mallet
or

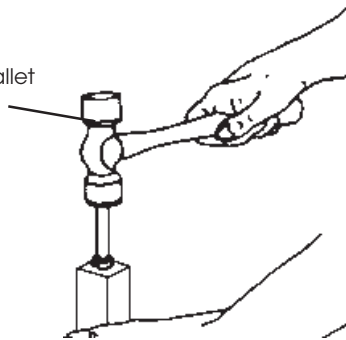

- 1.6 Remove the rotating centre and drive the spur centre into the other end of the wood. Make sure the spurs are in the saw cuts. Remove the spur centre.
- 1.7 Make sure the centres and the hole in the spindle and the tailstock spindle are clean. Insert the spur centre into the headstock and the rotating centre into the tailstock and tap them in lightly with a piece of wood. DO NOT DRIVE THEM IN.


NOTE:

If you use a 'dead centre' i.e not a rotating type, put a drop of oil or wax on the wood where it contacts the centre. This will lubricate the wood whilst it is turning.

- 1.8 Place the wood between the centres and lock the tailstock.
- 1.9 Move the rotating centre into the wood by turning the tailstock hand wheel. Ensure the centres are "seated" into the wood, into the holes made in steps 5 and 6 above.

Rotate the wood by hand whilst turning the

Fig. 14

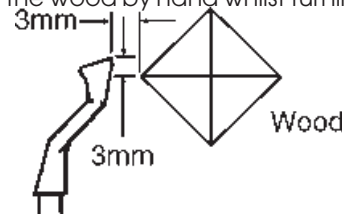


tailstock hand wheel.

- 5.10 Adjust the tool rest so that it is approximately 1/8" away from the corners of the wood and 1/8" above the centre line.
- Lock the tool rest base and the tool rest.
- 5.11 Consult the speed chart. Note that a 50mm square turning, up to 455mm long, should run at 838 RPM for "roughing". Check and adjust the drive belt if necessary.

IMPORTANT. ALWAYS rotate the wood by hand to guarantee that the corners do not strike the tool rest, and that the indexing pin is not engaged.

Fig. 15

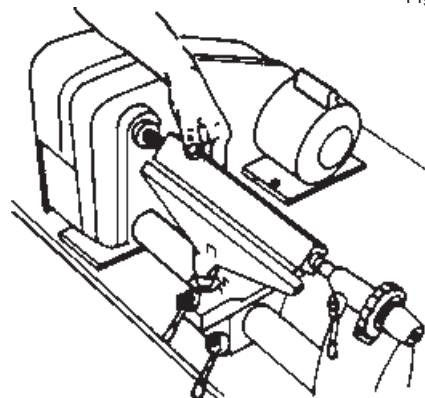

5.12 Check to ensure there are no spanners/ wrenches/pieces of wood or other debris in the area, and that your clothing is properly adjusted before pushing the ON button.

The procedure for cutting and the use of woodworking chisels is described under "Using Woodworking Chisels, starting on page 15. See also 'Spindle Turning' on page 24.

2. FACEPLATE TURNING

Turning which cannot be worked through centres, must be mounted on a faceplate, or other work-holding device. (Some jobs may require the use of special chucks).

All face plate work is done by scraping. Any attempt to use a cutting technique on edge grain, will result in hogging or gouging, which may tear the tool out of your hands.

For Faceplate turning, the work (suitably trimmed so that it is as near to its final dimension as possible), should be firmly mounted on to the faceplate, using screws as appropriate (see fig 16).

The complete assembly is then screwed on to the headstock spindle, and tightened securely, by holding the faceplate, and turning the spindle nut using a 27mm or 1-1/16 AF spanner, to lock it up against the faceplate boss.

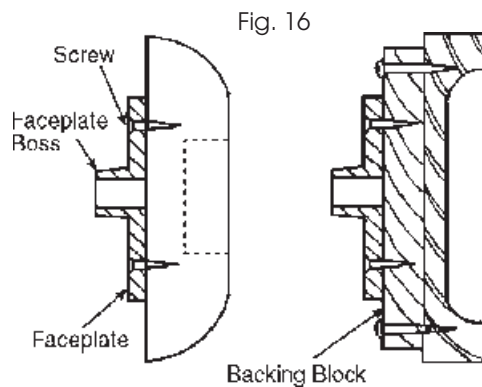


Fig. 16

The screws used in securing the work to the face plate, must not be of sufficient length as to interfere with the tool at the final dimension. It may be necessary to screw the work to a backing piece, depending upon design, or where screws are not permissible at all, the work may be glued to a backing piece, fitting a piece of paper at the joint, which will allow for later separation without damaging the wood.

3. INDEXING



Fig. 17

The spindle pulley contains 36 equally spaced holes. The index pin engages with these holes to keep the spindle from turning whilst you put a mark on the workpiece.

For example, to locate the position of six spokes in a wheel :

- 2.1 Pull the index pin outward and turn it so that the small cross pin slips into the slot. This will allow the index pin to engage in one of the holes in the pulley and prevent the spindle from turning.
- 2.2 Adjust the tool rest approximately at the centre line of the workpiece and make a mark.


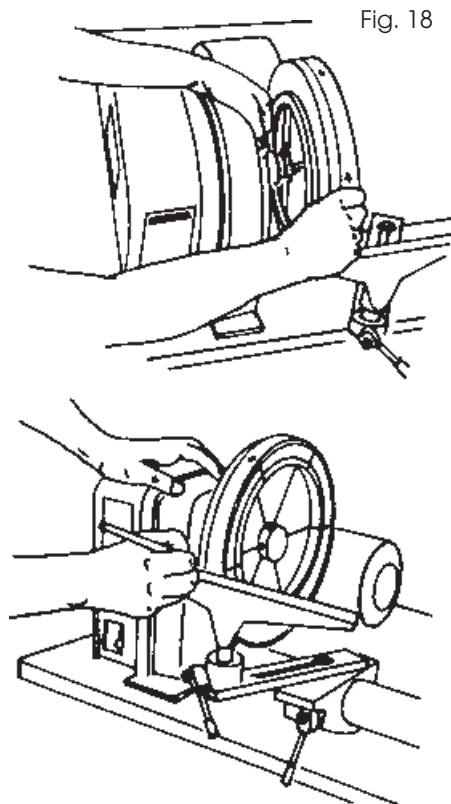


Fig. 18

- 2.3 Pull out the index pin and slowly rotate the workpiece until the pin slides into the next hole in the pulley.
- 2.4 Do this six times and put the next mark on the workpiece. The two marks will be spaced 60° apart. Continue this operation until six spokes are marked 60° apart.
- 2.5 Spindle turning can be divided in the same manner.

WARNING: The indexing pin must be disengaged for all other operations on the lathe.

Fig. 19

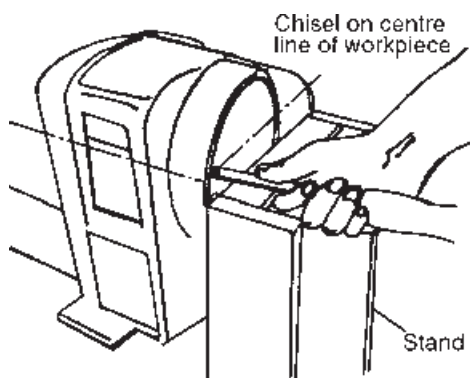

3. OUTBOARD TURNING

This technique is used to do jobs that are too large to mount conventionally. It is straight forward faceplate turning except that because of the work size, extra caution must be taken and speeds must be restricted to minimums.

In order to perform outboard turning operations, you must first build a stand similar to the one shown in Fig. 19. This is no more than a tool rest support.

Ensure that the top-to-floor distance allows you place the chisel on the work centre line.

DO NOT PUSH THIS SUPPORT WHEN CUTTING.

DO NOT TRY TO MOUNT WORK SO LARGE THAT THE MOTOR MUST STRAIN TO TURN IT.

IF YOU WISH TO EXPERIMENT WITH THIS TECHNIQUE DO SO WITH SOFT WOODS - LET THE HEAVIER, HARDER WOOD COME LATER.

The outboard end of the spindle is under the pulley cover and is protected by a plastic cap. This end is provided with a left hand thread which will accept available face plate accessories .

Remove the protective cap, and screw on the face plate with workpiece attached. (See face plate turning on page 26).

USING WOODWORKING CHISELS



1. SELECTION OF CHISELS

Better chisels have handles approximately 10" (250mm) long, to provide plenty of grip and leverage. Sharp tools are essential for clean, easy work. Buy tools that will take and hold keen edges.

An 8 piece chisel set is available from your CLARKE dealer, part no. 6500649


2. THEORY OF TURNING

There are two classes of chisel; these are :

- a. Chisels intended primarily for cutting, and
- b. Chisels used only for scraping.

The cutting chisels are the gouge, skew and parting tool. These are most commonly used. They are sharpened to a razor edge by honing on both sides.

The scraping chisels are the flat nose, round nose and spear point. These are not honed on the flat sides, the wire edges produced by grinding are left on to aid in the scraping process.

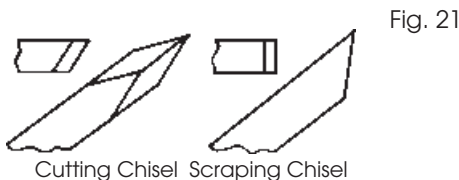

2.1 Cutting and Scraping


To cut, the chisel is held so that the sharp edge actually digs into the revolving work to peel off a shaving.

To scrape, the chisel is held at a right angle to the work surface as shown in fig. 22, and removes fine particles instead of shavings.

Many operations require that the cutting chisels be used for scraping, but scraping chisels are never used for cutting. Scraping dulls a chisel must faster, especially the razor sharp cutting chisels.

Cutting is faster than scraping and produces a smoother finish which requires less sanding. However, it is far more difficult to master. Scraping, on the other hand, is far more precise and easier to control.


2.2 When You Can Cut and When You Must Scrape.

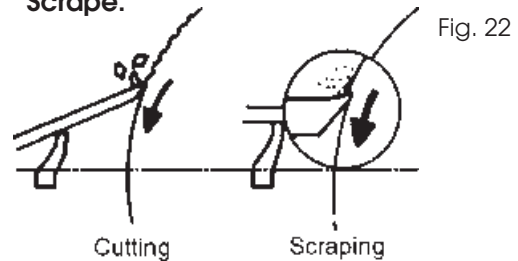

There are two different types of cut to consider when turning.

One is cutting at the circumference of the workpiece (for example, turning down the outer surface of a cylinder or the inner wall of a hollow round box, as shown in fig. 23). In this approach the surface being turned travels under the chisel edge like an endless belt.

The second type is cutting at the diameter of a workpiece (as when turning the face of faceplate turning or the side of a large shoulder on a spindle turning, as shown in fig. 23). In this approach the surface being turned rotates like a disc under the chisel edge. Sometimes the approach will be a combination of both.

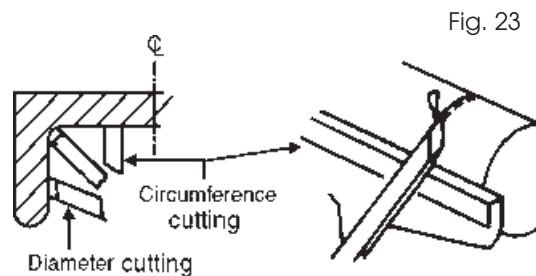

Either a cutting or scraping action can be used when cutting at the circumference. The shaving is removed like a peeling from a potato.

Scraping only, is used when cutting at the diameter. The reason is obvious when you consider that faceplate turning always requires removal of wood across the grain. Wood does not peel easily across the grain, and attempts to use a cutting method will result in damage to the work and throwing of the chisel by the work. It follows that a cutting action is used for the majority of spindle turning operations, whilst the majority faceplate turning is done by the scraping method.

When a combination approach is to be used, you will have to judge, by the feel of the work, when to stop cutting and start scraping.


Never try to cut when it becomes difficult to hold the chisel against the roughness of the wood grain.

2.3 How To Position The Tool Rest for Circumference Cutting


When cutting, the object is to pierce the outer skin of wood to a certain desired depth, then to hold the chisel steady, with the bevel edge parallel to the work circumference, so that it will peel off a shaving at this desired depth.

The only sure method of holding the chisel steady is to rest the bevel against the work, as shown in sketch 1.

When the tool rest is at the proper height, the chisel can be held with the bevel pressed against the work, and the tool rest will act as a fulcrum to support the chisel against the downward force of the revolving work.

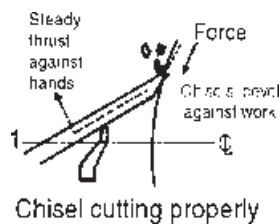


If the rest is placed too low, so that the chisel is held with the bevel out from the work (Sketch 2), the cutting edge will continue to dig deeper into the work. It will dig in until the "bite" becomes so deep that your hands have

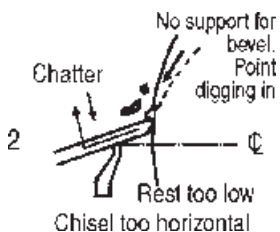


difficulty holding the chisel, then the improperly supported chisel will begin to bounce, or chatter, against the workpiece.


If the rest is placed too low, the chisel must be held extremely high to position the bevel against the work (Sketch 3). Then the rest loses most of its value as a fulcrum, and the downward force of the revolving workpiece tends to kick the chisel back out of your hands.

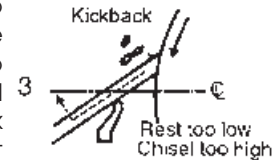


If the rest is placed too high, (Sketch 4) and the chisel is correctly positioned for cutting, it strikes the workpiece near the top where the direction of force exerted by the workpiece is nearly horizontal, and kickback will again result.

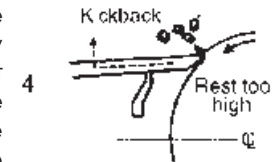


If the rest is placed too far out from the work surface (Sketch 5) then, when correctly held, the chisel is again too high on the work. Also, you have less leverage on your side of the tool rest, and it is even more difficult to hold the chisel.

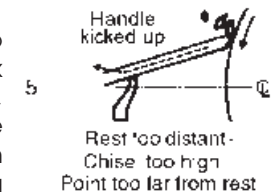

With large diameter work (Sketch 6), the tool rest can be above the workpiece centre line, and somewhat out from the work surface.

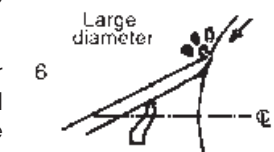

With small diameter work (Sketch 7), the rest should not be far from the work surface. As work grows smaller, the rest should be

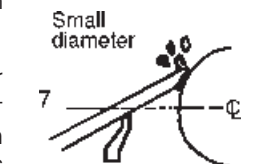

2.4 How to Position Tool Rest for Circumference Scraping

In scraping operations, the tool rest position is not as critical as it is for cutting operations. The chisel generally is held horizontally, though it can be held at an angle to reach into tight places. Considering that the wire edge of the chisel does the scraping, sketches 9 and 10 show the results of too low or too high a position for the rest, and sketch 8 shows the chisel action with the rest correctly positioned.


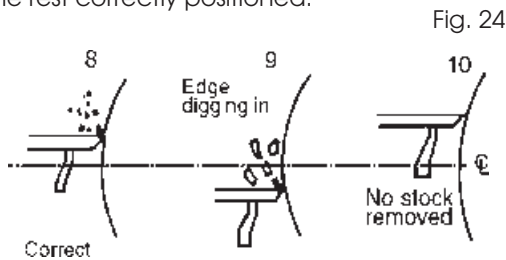


Fig. 24

2.5 How to Position Chisel and Rest for Diameter Scraping

Fig. 25

When scraping on the diameter, that position of

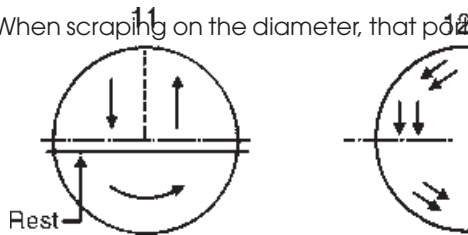


surface to the right of centre is moving upwards (Sketch 11). If the chisel is placed in this area, it will simply be carried up off the rest and out of your hands. All diameter scraping operations must be done at the left of centre.

Three different chisel contact points are shown in Sketch 12. It will be noted that, when the chisel is above the workpiece centre, or below it, the work surface sweeps past the chisels' edge at an angle and tends to carry the chisel in one direction or the other along the rest. Only when the chisel contacts the work on the centre line does the work surface pass squarely under the chisels edge. This then, is the position in which it is easiest to hold the chisel steady. To obtain this position, place the rest approximately 1/8" (3mm) - thickness of chisel, below the centre.

3. USING THE GOUGE

Fig. 26

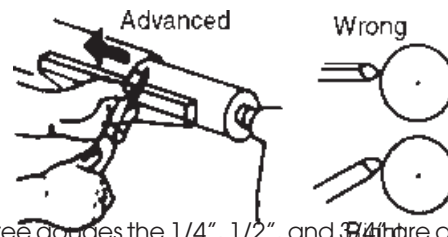


Three gouges the 1/4", 1/2", and 3/4" are ample for general DIY turning, but other sizes from 1/8" to 2" can be purchased.

The main use of the gouge is for rough circumference cutting of raw stock down to a cylinder of working size. It is the best tool to use for rapidly cutting away large areas of the workpiece, but when so used does not produce a smooth surface. With practice, it can be used for cutting coves and the shaping of long cuts. It is also useful for scraping.

When used for cutting, the gouge is always held with the convex side down. It should be rolled approximately 30° to 45° in the direction in which it is being advanced along the rest, and the cutting edge will be a little in advance of the handle.

4. USING THE SKEW

Two skews, the 1/2 and 3/4" sizes, are needed for general use. Other sizes are

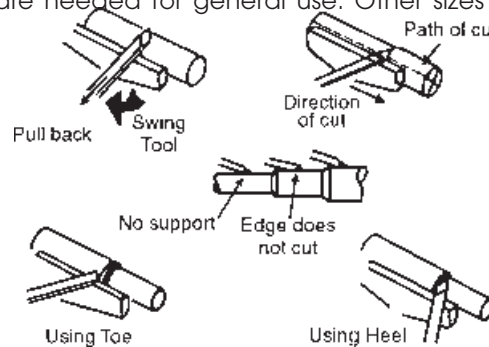


available. This tool is nearly always used to make finished cuts, to cut vees and beads, and to square shoulders. Properly used, it produces the best finish that can be obtained with a chisel. It should not be used for scraping, as this quickly dulls it.

For finish cutting, the skew is held with the cutting

bevel side down, keep the base of the bevel against the work. Good practice is to place the skew well over the work, pull it back until the edge begins to cut, then swing the handle into position to advance the cut. Both the toe and the heel of the skew can be used for taking light cuts, but do not penetrate the wood too deeply without cutting clearances, as there is danger of burning the tip of the tool.

5. USING THE PARTING TOOL

The parting tool has just one primary purpose to cut straight into the workpiece as deep as

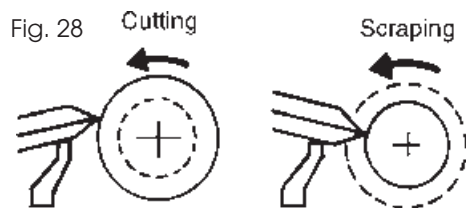

desired, or all the way through to make a cut-off, it is therefore a very narrow tool. 1/8 inch wide and shaped to cut its own clearance so that the edge will not be burned. When used for scraping, however, it should be backed off regularly to prevent overheating.

Unlike the gouge and skew, the parting tool is seldom held with the bevel against the work. As the amount of stock removed is small, a support for the bevel is not necessary. The tool is simply fed into the work at an angle (for cutting), or pointed at the workpiece centre (for scraping) it can be held easily in one hand.

6. USING THE SCRAPING CHISELS

Fig. 29



Spear Point **Round Nose** **Flat Nose**
A 1/2" wide spear point chisel, a 1/2" wide round nose chisel and a 1" wide flat nose chisel complete the list of tools ordinarily used by home craftsmen. Each of these scraping chisels can be purchased in various other sizes for special purposes. All are very useful for diameter scraping operations and for circumference scraping, when cutting methods cannot be employed.

The spear point is used for fine scraping and delicate operations, such as the forming of beads, parallel grooves and shallow vees. Edges and bowl contours can be rounded with the round nose chisel. Any flat surface can be scraped with the flat nose chisel.

7. USING SHAPER OR MOULDING KNIVES

Fig. 30



An old chisel can be made to serve as a holder for 'shaper' or 'moulding' knives. Such knives make it possible to scrape many interesting shapes in the workpiece surface in one or two operations instead of the many operations required with standard chisels. It is generally not practical to use cutting methods with special shape tools, scraping methods should be used.

The holder should provide a shoulder against which the butt end of the knife can be firmly seated, and the knife must be securely mounted, either by means of a screw threaded into the holder, or be compressing it between two prongs bolted together.

8. USING A BLOCK PLANE


Fig. 31



Clear glass smooth finishes (especially on soft woods) can be obtained by using a block plane set to take a fine shaving. The tool rest should be raised up approximately to the top of the workpiece, and the plane should be horizontal, but turned slightly in the direction of travel so that it will take a shearing cut. Two tool rests, one in front and the other behind the work, can be used to advantage in positioning the plane so as to exactly limit the depth of cut (and finished size of the workpiece).

9. USING WOOD RASPS AND FILES

Fig. 32

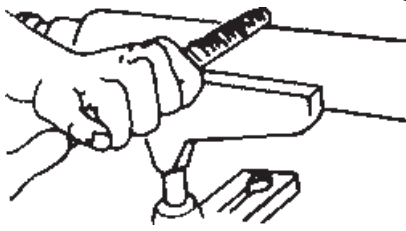

A wood rasp will remove stock quickly when held against the revolving workpiece. Care should be taken to support the rasp firmly against the tool rest however, as it can tear the hands painfully if caught by a rough edge of the workpiece and kicked back. The rasp will leave a very rough finish.


Finer finishes (similar to those produced by scraping), can be obtained by using files in the same manner. Various shape files can be used for shaping vees, beads, coves etc. If pressed into the wood too hard, however, a file can burn the workpiece surface. Keep the file clean to keep it cutting uniformly. Files work best on hard woods.

10. HAND POSITIONS

When handling a chisel, the hand takes a natural position, being nearer or farther from the end depending upon the amount of leverage required. The position of the tool rest hand is a matter of individual liking, but there are three generally accepted positions, each best for certain types of operations.

10.1 Roughing Off

Fig. 33

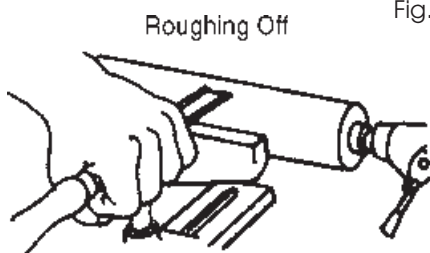

Roughing off and other heavy work requires a firm grip and solid positioning of the chisel against the rest. This is best obtained by the tool rest hand position as illustrated. The wrist is dropped down so that the heel of the hand below the little finger acts as a sliding guide against the rest. The handle hand controls chisel position.

10.2 Finish Cutting

Finish Cutting


Fig. 34



Finish cutting requires more control with less force and is better done with the palm of the tool rest hand turned up. The wrist is still held down, and the side of the index finger acts as a guide along the rest. In this position, control of the chisel is shared by both hands, the fingers of the tool rest hand being free to assist in positioning the tool.

10.3 Intricate Cutting

Fig. 35

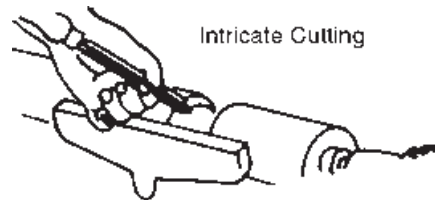

Intricate, delicate cutting requires extreme control, with practically no force. This is best accomplished by guiding the chisel with the fingers of the tool rest hand. The hand is held palm up, with the wrist high, and the little finger placed against the rest to steady the hand. The chisel does not touch the rest and the handle hand is completely secondary to the tool rest hand.

The first and second positions are equally good for scraping operations, but the third position is never used for scraping.

11. CUTTING TO DEPTH

Cutting to Depth

Fig. 36



Many scraping operations and cutting to depth with the parting tool can be easily done with one hand. The chisel is grasped firmly with the index finger on top, to press it down against the rest, and is thrust straight into the work. Holding the tool thus leaves the other hand free to hold a pattern, callipers etc., to check work progress.

MAKING STANDARD CUTS

1. THE ROUGHING OFF-CUT

Reducing a square or odd shaped workpiece down to a cylinder of approximate size for finish turning is called roughing-off. Faceplate turnings and large diameter spindles should first be partly reduced by sawing, but small spindles are easily turned down entirely with the large (3/4") gouge.

Start the first cut about 50mm from tailstock and

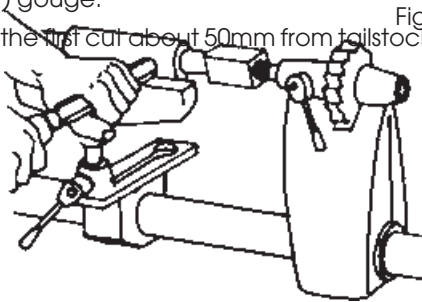


Fig. 37

then run it toward the tailstock and off the end of the workpiece.


Next, start another cut 50mm nearer the headstock and run it also toward tailstock to merge with first cut.

Continue in this manner until 50mm to 100mm from the headstock end, then reverse the direction of tool travel and work one or two cuts in succession toward the headstock and off this end of the workpiece.


Never start a cut directly at the end. If the chisel catches the end, it will damage the workpiece.

Never take long cuts while corners remain on the work, as this tends to tear long slivers from the corners.

The first series of cuts should not be too deep. It

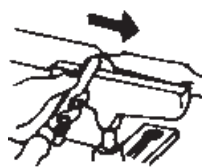

First Cuts

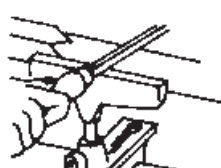

Testing Roundness

is better to partially reduce the work to a cylinder along its complete length, then start a second series of cuts to reduce it to a cylinder. Once a cylinder has been formed, step the lathe up to its next fastest speed. Further reductions in size can now be carried out by cutting as deeply as desired at any spot along the work.

At this stage long cuts from the centre of either

end can also be taken. Roughing-off generally is continued until the cylinder is approximately 3mm larger than the desired finished size. Roundness can be tested by laying the gouge on top of the work - it will not ride up and down when cylinder is perfectly round.

2. ROUGH-CUTTING TO SIZE

The roughing-off cut can be made to accurately

Fig. 37

A Sizing Cut



size the cylinder to a given diameter.

Another method is to make a number of sizing cuts at intervals along the work, then use the gouge to reduce the whole cylinder down to the diameter indicated by these cuts.

3. MAKING SIZING CUTS

Sizing cuts are useful to establish approximate finish-size diameters at various points along a workpiece. The work can then be turned down to the diameters indicated and be ready for finishing.

Diameters for sizing cuts should be planned to be about 3mm greater than the desired finished diameters.

A sizing cut is made with the parting tool. Hold the tool in one hand and use the other hand to hold an outside calliper, preset to the desired sizing-cut diameter.

As the cut nears completion, lower the chisel point more and more into a scraping position. When the callipers slip over the workpiece at the cut, the cut is finished.

4. SMOOTHING A CYLINDER

The final 3mm can be removed in two ways. Either use the 3/4" skew, working from the centre toward both ends and taking lighter and lighter cuts until finished.

5. CUTTING A SHOULDER

A shoulder can be the side of a square portion left in the workpiece, the side of a turned section or the end of the workpiece. Most shoulders are perpendicular to the work axis, but a shoulder can be at any angle desired.

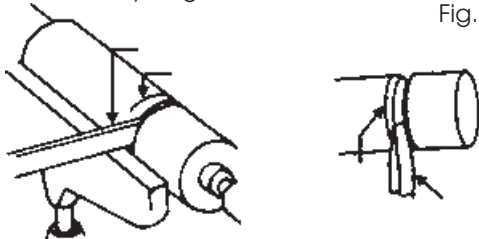


Fig. 40

First, mark position of the shoulder with a pencil held to the revolving workpiece. Then make a sizing cut with the parting tool, placing this cut about 2mm outside the shoulder position and cutting to within about 3mm of the depth desired for the area outside of the shoulder.

If shoulder is shallow, the toe of the skew can be used to make the sizing cut, but do not go in deeper than 3mm with the skew unless wider and wider vees are cut to provide clearance for this tool.

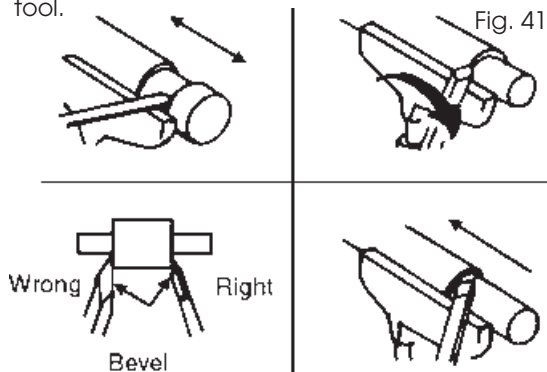


Fig. 41

Use the gouge to remove any waste stock outside of shoulder, and smooth this section up to within 3mm of the shoulder in the usual manner. Finishing of the shoulder unless it is more than 25mm high is best done with the 1/2" skew. First, the toe of the skew is used to remove shavings from the side of the shoulder, down to finish size. Hold the skew so the bottom edge of the bevel, next to shoulder, will be very nearly parallel to side of shoulder, but with the cutting edge turned away at the top, so that only the extreme toe will do the cutting.

If the cutting edge is flat against the shoulder, the chisel will run. Start with the handle low, and raise handle to advance toe into the work.

Cut down to finished diameter of outside area, then clean out the corner by advancing the

heel of the skew into it along the surface of the outside area.

Tilt the cutting edge with handle raised up, so that only the extreme heel does this cutting. If the shoulder is at the end of work, the process is called squaring the end. In this case, reduce outer portion to a diameter about 6mm larger than tool centre diameter, then later saw off the waste stock.

6. CUTTING VEES

Vee grooves can be cut with either the toe or heel of the skew. When the toe is used, the cutting action is exactly the same as in trimming a shoulder, except that the skew is tilted to cut at the required bevel. Light cuts should be taken first on one side then the other, gradually enlarging the vee to the required depth and width.

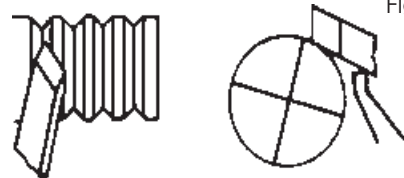


Fig. 42

When the heel is used, the skew is rotated down into the work, using the rest as a pivot. Otherwise, the cutting position and sequence of cuts is the same.

As when using the toe, it is important that cutting be done only by extreme end of cutting edge.

If deep vees are planned, it is quicker to start them by making a sizing cut at the centre of each vee. Vees can also be scraped with the spear point chisel or a three-sided file.

7. CUTTING BEADS

This requires considerable practice.

First, make pencil line to locate the tops (highest points) of two or more adjoining beads. Then make a vee groove at the exact centre between two lines, and down to the desired depth of the separation between the beads.

Be careful not to make the groove too wide or you will remove portions of the desired beads.

The sides of the two adjoining beads are now cut with the heel of the skew, preferably 1/2" size, unless beads are quite large. Place the skew at right angles to the work axis, flat against the surface and well up near the top. The extreme heel should be just inside the pencil line that marks the top of the bead.

MAKING STANDARD CUTS

1. THE ROUGHING OFF-CUT

Reducing a square or odd shaped workpiece down to a cylinder of approximate size for finish turning is called roughing-off. Faceplate turnings and large diameter spindles should first be partly reduced by sawing, but small spindles are easily turned down entirely with the large (3/4") gouge.

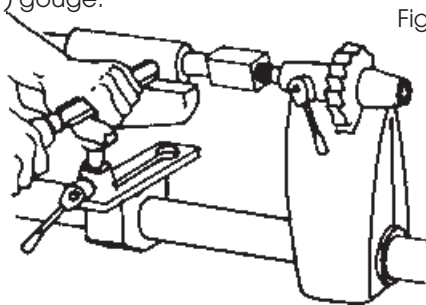


Fig. 37

Start the first cut about 50mm from tailstock and then run it toward the tailstock and off the end of the workpiece.


Next, start another cut 50mm nearer the headstock and run it also toward tailstock to merge with first cut.

Continue in this manner until 50mm to 100mm from the headstock end, then reverse the direction of tool travel and work one or two cuts in succession toward the headstock and off this end of the workpiece.

Never start a cut directly at the end. If the chisel catches the end, it will damage the workpiece.

Never take long cuts while corners remain on the work, as this tends to tear long slivers from the corners.

Fig. 37

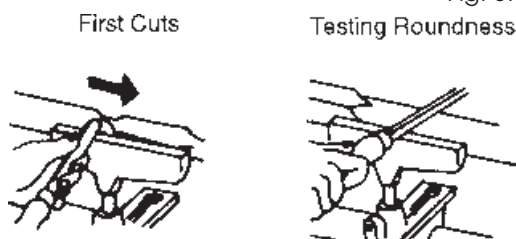

The first series of cuts should not be too deep. It is better to partially reduce the work to a cylinder along its complete length, then start a second series of cuts to reduce it to a cylinder. Once a cylinder has been formed, step the lathe up to its next fastest speed. Further reductions in size can now be carried out by cutting as deeply as desired at any spot along the work.

At this stage long cuts from the centre of either end can also be taken. Roughing-off generally is continued until the cylinder is approximately 3mm larger than the desired finished size. Roundness can be tested by laying the gouge on top of the work - it will not ride up and down when cylinder is perfectly round.

2. ROUGH-CUTTING TO SIZE

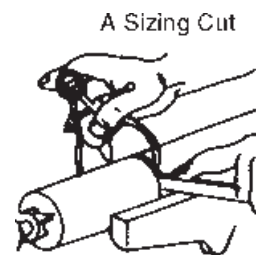


Fig. 37

The roughing-off cut can be made to accurately size the cylinder to a given diameter.

Another method is to make a number of sizing cuts at intervals along the work, then use the gouge to reduce the whole cylinder down to the diameter indicated by these cuts.

3. MAKING SIZING CUTS

Sizing cuts are useful to establish approximate finish-size diameters at various points along a workpiece. The work can then be turned down to the diameters indicated and be ready for finishing.

Diameters for sizing cuts should be planned to be about 3mm greater than the desired finished diameters.

A sizing cut is made with the parting tool. Hold the tool in one hand and use the other hand to hold an outside calliper, preset to the desired sizing-cut diameter.

As the cut nears completion, lower the chisel point more and more into a scraping position. When the callipers slip over the workpiece at the cut, the cut is finished.

4. SMOOTHING A CYLINDER

The final 3mm can be removed in two ways. Either use the 3/4" skew, working from the centre toward both ends and taking lighter and lighter cuts until finished.

5. CUTTING A SHOULDER

A shoulder can be the side of a square portion left in the workpiece, the side of a turned section or the end of the workpiece. Most shoulders are perpendicular to the work axis, but a shoulder can be at any angle desired.

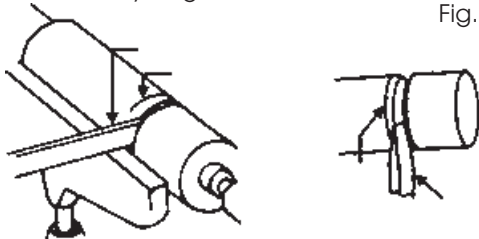


Fig. 40

First, mark position of the shoulder with a pencil held to the revolving workpiece. Then make a sizing cut with the parting tool, placing this cut about 2mm outside the shoulder position and cutting to within about 3mm of the depth desired for the area outside of the shoulder.

If shoulder is shallow, the toe of the skew can be used to make the sizing cut, but do not go in deeper than 3mm with the skew unless wider and wider vees are cut to provide clearance for this tool.

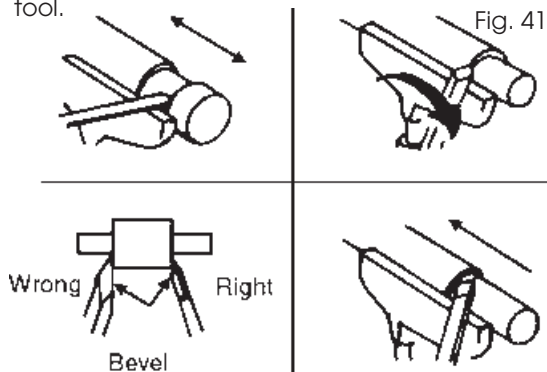


Fig. 41

Use the gouge to remove any waste stock outside of shoulder, and smooth this section up to within 3mm of the shoulder in the usual manner. Finishing of the shoulder unless it is more than 25mm high is best done with the 1/2" skew. First, the toe of the skew is used to remove shavings from the side of the shoulder, down to finish size. Hold the skew so the bottom edge of the bevel, next to shoulder, will be very nearly parallel to side of shoulder, but with the cutting edge turned away at the top, so that only the extreme toe will do the cutting.

If the cutting edge is flat against the shoulder, the chisel will run. Start with the handle low, and raise handle to advance toe into the work.

Cut down to finished diameter of outside area, then clean out the corner by advancing the

heel of the skew into it along the surface of the outside area.

Tilt the cutting edge with handle raised up, so that only the extreme heel does this cutting. If the shoulder is at the end of work, the process is called squaring the end. In this case, reduce outer portion to a diameter about 6mm larger than tool centre diameter, then later saw off the waste stock.

6. CUTTING VEES

Vee grooves can be cut with either the toe or heel of the skew. When the toe is used, the cutting action is exactly the same as in trimming a shoulder, except that the skew is tilted to cut at the required bevel. Light cuts should be taken first on one side then the other, gradually enlarging the vee to the required depth and width.

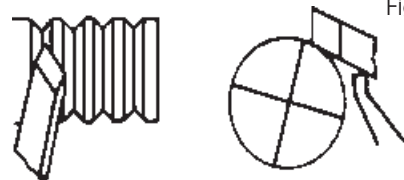


Fig. 42

When the heel is used, the skew is rotated down into the work, using the rest as a pivot. Otherwise, the cutting position and sequence of cuts is the same.

As when using the toe, it is important that cutting be done only by extreme end of cutting edge.

If deep vees are planned, it is quicker to start them by making a sizing cut at the centre of each vee. Vees can also be scraped with the spear point chisel or a three-sided file.

7. CUTTING BEADS

This requires considerable practice.

First, make pencil line to locate the tops (highest points) of two or more adjoining beads. Then make a vee groove at the exact centre between two lines, and down to the desired depth of the separation between the beads.


Be careful not to make the groove too wide or you will remove portions of the desired beads.

The sides of the two adjoining beads are now cut with the heel of the skew, preferably 1/2" size, unless beads are quite large. Place the skew at right angles to the work axis, flat against the surface and well up near the top. The extreme heel should be just inside the pencil line that marks the top of the bead.

Now draw the skew straight back whilst raising the handle slowly, until the edge of the heel at the pencil line starts to cut.

As the edge begins to cut, roll the skew in the direction of the vee, so that the exact portion of the edge, when started cutting, will travel in a 90° arc down to the bottom of the vee.

Upon reaching the bottom of the vee, the skew should be on edge. Reverse the movements to cut the side of the adjacent bead.

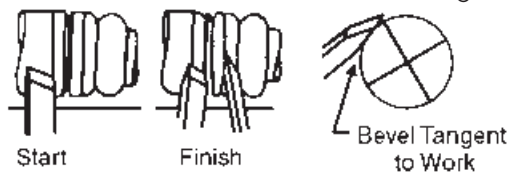

It is important that only the extreme heel should do the cutting. This means that the bottom edge of the bevel, next to the vee, must at all times be tangent to the arc of the bead being formed.

Easier beads can be shaped with a spear point chisel. Use pencil marks and sizing cuts as before. Push the chisel straight into each cut and rotate it horizontally to round off the adjacent edges. It must be moved slightly in the direction of rotation at the same time, to keep the point from digging into the adjacent bead.




8. CUTTING COVES (CONCLAVES)

This is the most difficult single cut to master, but one of the most important in good wood turning. First, use pencil marks to indicate the edges. Then rough-it out to within about 3mm of the desired finish surface by scraping with the gouge or round nose chisel. If the cove is to be very wide, sizing cuts can be made to plot the roughing out.

Once it is roughed out, the cove can be finished in two cuts, one from each side to the bottom centre.

At the start of either cut, the gouge is held with handle high and the two sides of blade held between the thumb and forefinger of tool rest hand, just behind the bevel.

Position the fingers ready to roll the blade into cove. Hold the blade so that bevel is at a 90° angle to the work axis, with the point touching the pencil line and pointing into work axis.

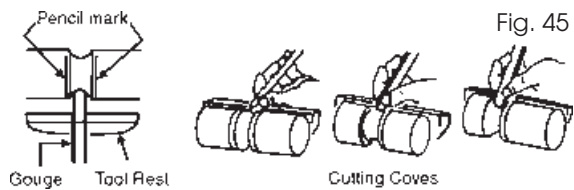

From here, depress the tip slightly to start the cut, then continue to move tip down in an arc toward the bottom centre cove, at the same time rolling chisel uniformly so that at the end of the cut it will be flat at the bottom of the cove. The object is to keep the extreme tip of the gouge doing the cutting from start to finish. Reverse movements to cut the opposite side.

Coves can be scraped to finish using the round nose chisel or a file, but these methods do not generally produce perfectly curved coves.



Chisel inclined in direction of cut

9. MAKING A LONG CONVEX CUTS

First turn work down to approximate size, using sizing cuts (as required) to determine various diameters. Finish cut can then be made with either skew or gouge.

If the skew is used, the principles of operation are the same as those employed in cutting a bead, except that the curve is longer and may be irregular. Use the extreme heel throughout. Start at the longer end of the curve (if curve is irregular) and progress toward the steeper end. If a gouge is used, make the cut in the same direction. Start with the handle well back from the point, swinging it in the direction of tool travel to overtake the point, if necessary, when the steeper part of the curve is reached. The object is to keep the extreme point doing the cutting throughout, with the bevel at a tangent to the curve as much as possible.

10. MAKING LONG TAPER CUTS

Long taper cuts are made like long convex cuts, with the skew or gouge. However, the angle between the cutting edge and handle is kept constant during the entire cut. The handle is not swung around. Always cut downhill. Do not cut too deeply at the centre of the taper.

SPINDLE TURNINGS

1. PLOTTING THE SHAPE

Once the basic cuts have been mastered, you are ready to turn out finished work.

The first step is to prepare a plan for the proposed turning. This can be laid out on a suitable sheet of paper, and should be to full size.

Next, prepare the turning stock by squaring it up to the size of the largest square or round section in your plan. The stock can be cut to the exact length of the proposed turning, but in most cases it is best to leave the stock a little long at one or both ends to allow for trimming.

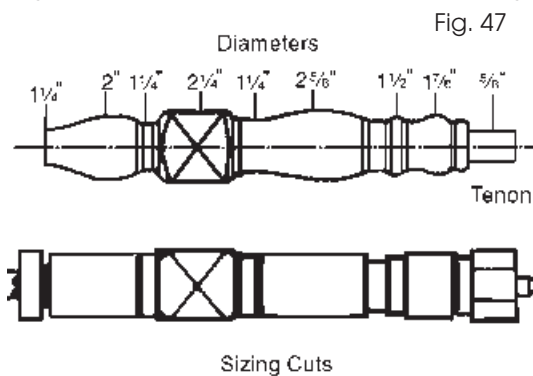


Fig. 47

Mount the stock in the lathe, and rough it off to a maximum size cylinder. Now project your plan on to the turning by marking the various critical dimensions along the length of the spindle in pencil. These dimensions can be laid out with an ordinary ruler, or by using a template. Make the pencil marks about 12mm long, they will be visible when the work is revolved under power, and can be quickly traced around the spindle by touching each line with the pencil.

After marking, use the parting tool to make sizing cuts at all of the important shoulders. When learning, you will find it best to make sizing cuts to accurately plot the various diameters, but experienced workers can do with a few such cuts at the important shoulders.

Plan each sizing cut so that it is in waste stock, and make each deep enough so that there will be just enough wood left under the cut for the finishing process.

Once the sizing cuts have been run in, rough-out the excess wood with a gouge, then proceed with the finishing process by making the various types of cuts required.

2. DUPLICATE TURNINGS

Identical turnings require great accuracy when plotting the work and doing the various cuts. Many methods have been devised to assist in perfecting the work.

2.1 Use of Patterns

Professional workers generally use a pattern or layout board.


This is a thin piece of wood or cardboard on which is drawn a full-size half section of the turning. The contour of the finished surface is drawn first, then the diameters at various critical points are drawn to scale as vertical lines intersect the contour line.

By placing the pattern against the roughed-out-cylinder, you can quickly mark the various points of the critical diameters.

To make each sizing cut, use outside callipers and set these by actually measuring the length of the vertical line on the pattern which represents the diameter desired. Then make the sizing cut, down to the proper diameter by using the callipers to determine when the cut is finished.

After making the sizing cuts, hang the pattern behind the lathe where it will serve as a guide for completion of the workpiece.

Fig. 48

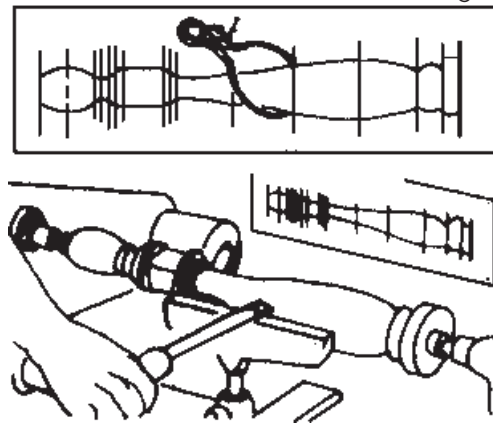

2.2 Using a Template and a Diameter Board

When many identical turnings are to be produced, it is convenient to have a prepared template. This can be made of thin wood or cardboard, and is cut on a band saw or scroll saw to have the exact contour of the finished

turning. The first finished turning can also be used as a template.

Attach the template to a board, then mount the board behind the lathe on hinges, so that the template can be moved down to touch the workpiece and allow you to closely observe progress of your work.

If a great many turnings are being produced, a diameter board will save the time used for resetting callipers. This is simply a thin board along the edge of which a number of semicircular cuts have been prepared to represent all the various calliper settings required for measuring the sizing cuts. Each semicircular cut is held against the workpiece instead of using the callipers.

Using a Template

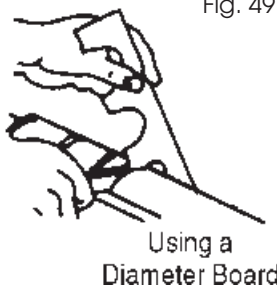


Fig. 49

Using a Diameter Board



3. LONG SPINDLES

A long turning can be worked in short sections, with joints arranged to be at shoulders where they will not be noticed.

Long thin work that is likely to whip while turning should be supported at one or two places by a backstick. This is easy to make. A simple one consists of a short length of wood mounted vertically in an extra tool rest, and notched so that it can be used to support the spindle from behind. An improved type which uses 2 roller skate wheels to form the notch-size is shown.

Fig. 50

Use of Backsticks

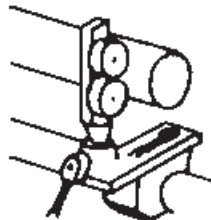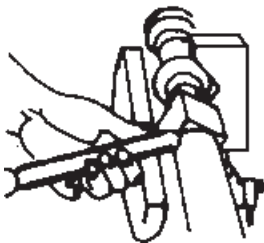

Position the backstick against a pre-turned portion near the centre of the spindle, this portion being at least 3mm over finish size to allow for later removal of any marks made upon it.


Operate lathe at a slower speed than normal. Lubricate the workpiece at point of contact with the backstick, using beeswax (preferably), or grease.

After completing the turning, remove the backstick and finish off the original point of contact. Sand off any slight burns remaining on workpiece.

4. CUTTING DOWELS

Dowels of any size can be turned quickly with the simple jig shown. If the stock is prepared as a split or quartered turning, half round and quarter rounds will be produced.

fig. 51

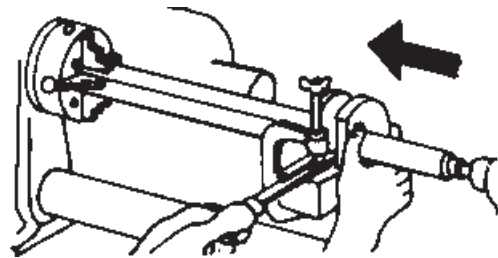

The jig uses a 1/2" gouge as the cutting tool and will produce dowels up to 11mm diameter. Make the jig from suitable hardwood stock as shown.

The hole through the jig must be large enough at the side, to the left of the gouge, to allow passage of the square stock. At the right of the gouge this hole must be just the diameter of the finished dowel. Make the jig so you can hold and guide it by hand.

To start, centre the stock as you would for a spindle turning and turn down about 50mm at the right end to desired size.

Then remove the stock, place your jig over the turned end, with turned portion through the smaller jig hole, and re-centre the stock on the lathe.


Hold the jig firmly and start the lathe. Push the jig slowly right to left along the stock until the whole dowel is complete.

MISCELLANEOUS OPERATIONS

1. GUIDE BLOCKS FOR SCRAPING OPERATIONS

A guide block can be clamped to a chisel to limit the depth of cut and aid the production of perfect cylinders, tapers and facings on faceplate turnings. Scraping methods must be used when the guide block is employed.

Fig. 52

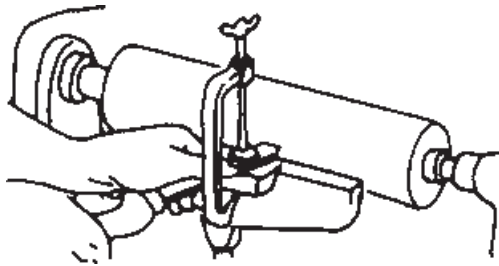

it in the headstock, using a 4-jaw (metal-lathe) chuck or a Jacobs chuck.

When this method is employed, there is no accurate support for the workpiece so that centre drilling is difficult. However, cross drilling, or drilling random holes through stock can be accomplished quickly in this manner.

For cross drilling flat sided work, use a (metal-lathe) drill pad in the tailstock and place a scrap board between the pad and the work.

For cross drilling round stock, use a (metal-lathe) crotch centre in the tailstock. Work may be supported on supporting blocks laid upon the lathe bed, it can be held by hand or can be supported from behind by a drill pad mounted in the tailstock.


2. DRILLING

There are several methods of using the lathe for drilling centre holes through wood stock.

When the drill is properly mounted, centering of the hole is automatic. One method is to mount the drill to the tailstock, while the work is held and revolved by the headstock. If the drill has a Morse taper shank, it can be mounted directly in some tailstock spindles. Otherwise, it can be mounted in a chuck fitted with the proper type shank.


Another method of holding the drill is to mount

Fig. 53

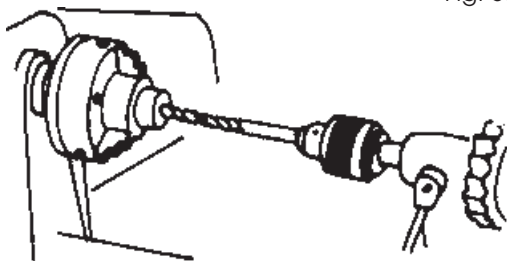

Cross Drilling

Fig. 54

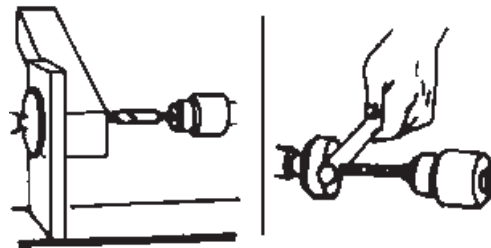

FACEPLATE & CHUCK TURNINGS

1. PLANNING THE WORK

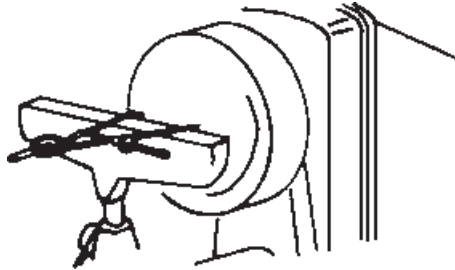


Fig. 55

Make a layout first, to provide a visual pattern to follow while working the turning. Patterns can be laid out in the same manner as spindle patterns, or templates can be made which can be held against the work for visual comparison. Circles to locate the various critical points (at which the contours of the faceplate take distinct form) can be quickly scribed on the rotating work by using dividers (see above).

2 PLANNING VARIOUS CUTS

The circumference of a faceplate turning is roughed-out and finished in the same manner as that for a spindle. Practically all of the balance of the operations however, are done by using scraping methods.

A few of the standard contours which are often turned are illustrated in fig.56, which also shows the proper chisels for shaping these contours. Any roughing out to depth that must be done is generally accomplished with the gouge held in the scraping position.

3. DEEP RECESSES

The first step is to remove as much wood as possible by boring into the centre with the largest

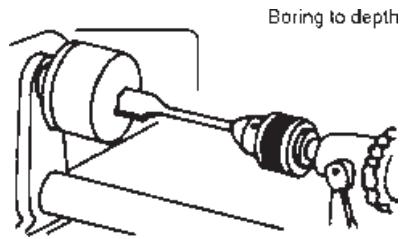


Fig. 57

wood bit available. This can be accomplished as illustrated above, or in any of the ways shown on pages 18 & 19. Be careful to measure in advance the depth to which the drill can be allowed to go.

Now remove the bulk of the waste (to rough-out the desired recess), by scraping with the round-nose chisel or the gouge. Remove up to within 1/8" of finished size in this manner.

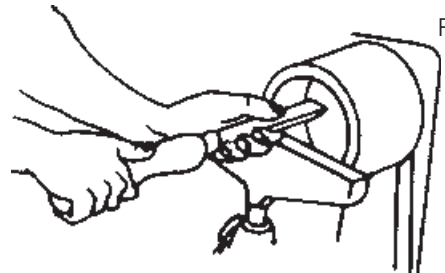


Fig. 58

Finish off the inside circumference by scraping with the spear point chisel or skew. Smooth the bottom of the recess by scraping it flat with the flat nose chisel.

Proper support must be provided at all times for the scraping chisels. Several tool rest positions are shown in the accompanying illustrations. Always endeavour to position the part of the rest that supports the tool as close to the working surface as possible.

The depth and squareness of the sides of the recess can be quickly checked by holding one of the straight sided chisels and a combination square as shown.

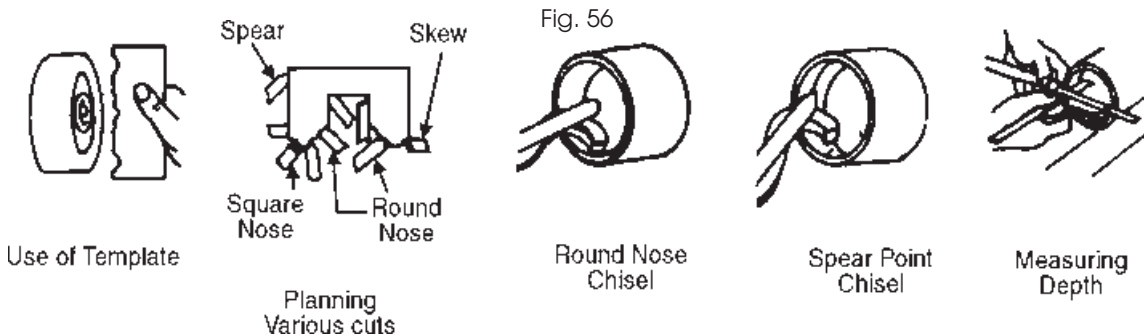


Fig. 56

Round Nose Chisel

Spear Point Chisel

Measuring Depth

FANCY FACEPLATE TURNINGS

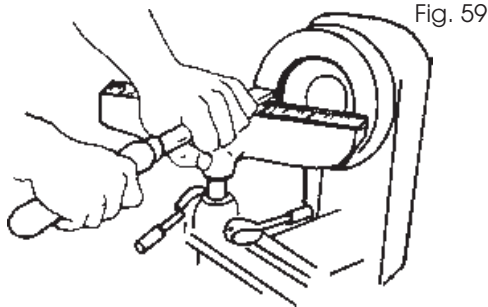


Fig. 59

1. PREPARING A PLUG CHUCK

A plug chuck is an auxiliary wood chuck mounted onto a faceplate. The chuck can be any size diameter, should be about 65mm thick for stability and should be provided with a 20mm hold in the centre for receiving a tenon turned at the end of the workpiece. Once made, such chucks are permanent useful fixtures for turning balls, goblets etc. In use, the wood stock for turning is turned between centres to produce a tenon at one end which will be a driving fit in the hole of the chuck. When mounted in the chuck, the workpiece is substantially supported for any faceplate type of turning.


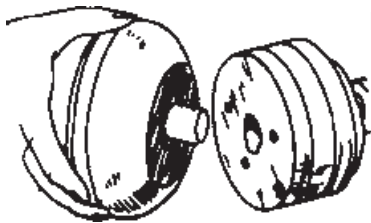


Fig. 60

2. TURNING CYLINDERS

Stock for cylinders should be mounted on the screw centre or a small faceplate. The tailstock can be brought up to support the work while the circumference is being turned and finished. Afterwards, the tailstock is backed off and the outer end of the cylinder is recessed, using methods already described for making deep presses.

Fig. 61

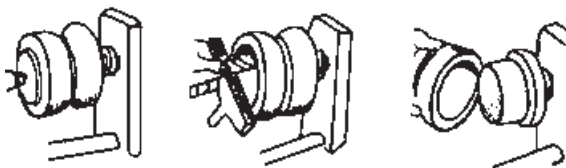

After making a recess at least 1/2 the way through the workpiece, and finishing this on the inside, remove the workpiece from the lathe. Now mount a short length of soft wood stock on the screw centre and turn this down to form a dowel that will be a tight press (not driving) fit inside the recessed end of the cylinder. Mount the cylinder on this wooden chuck, and recess the unworked end deep enough to form a perfect hole through the entire cylinder.

3. RECHUCKING

Rechucking is the general term used to describe any additional work mounting that is necessary to complete a turning project. The method of working cylinders, and the use of a plug chuck as already described are typical examples. Another good example is the rechucking of a bowl.

Fig. 62




The work is mounted on a wood backing block secured to the large faceplate, and is turned in the usual manner, except for the back side (which is against the mounting block). It is then removed from the mounting block. An auxiliary chuck of soft wood is now made in the same manner as that for the cylinder chuck. This chuck must have a turned recess properly sized to accommodate the rim of the bowl in a tight press fit. When the bowl is mounted in this chuck, the bottom can be cleaned off and slightly recessed to complete the desired contours.

4. TURNING A RING

One method of turning a ring requires a spindle chuck. The work stock is first mounted to a backing block held by the large faceplate, and is turned to shape on the outer side. The inside diameter of the ring is also shaped, all the way through to the backing block. The work is then removed from the backing block. A spindle chuck is now prepared so that it will be a tight press fit inside the ring, and the ring is reversed


and mounted on this chuck. thus mounted, the remaining contours can be turned to shape.

Fig. 63

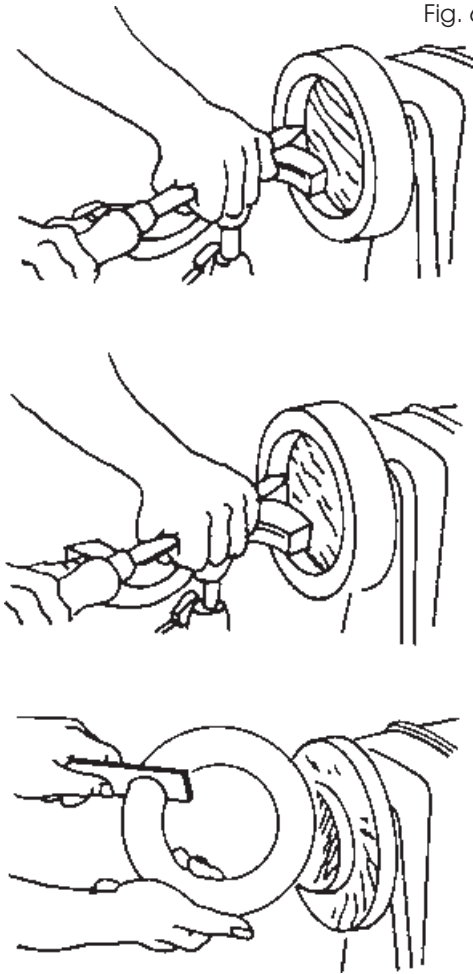

Another method of turning a ring makes use of a recessed chuck. The work stock is mounted on a screw centre and one half of the ring is formed, but the ring is not cut away from its centre. The stock is then removed and a recessed chuck, mounted on the large faceplate, is prepared to receive the ring in a tight press fit.

Fig.64

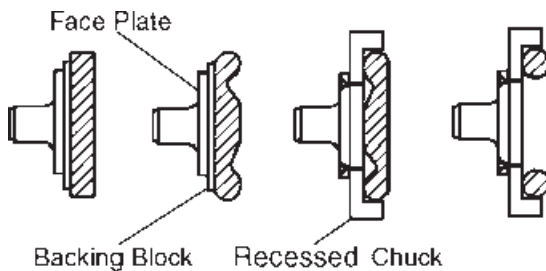


After being chucked the remaining face of the ring can be turned to the proper contour, thus cutting away the centre portion.

Work of this type take constant measurements, or better still, use a template to guard against over or under cutting.


5. TURNING BALLS

Fig. 65

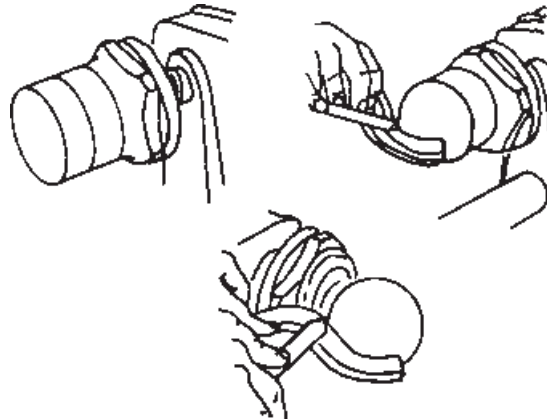

Wooden balls of large size are first roughly turned between centres, using standard procedures. Smaller balls can be mounted as face plates on the small faceplate of screw centre. Lines drawn to indicate the centre and ends of the ball shape are helpful in plotting the curve. A template should always be used for accurate visual observation of the work progress.

Fig. 66

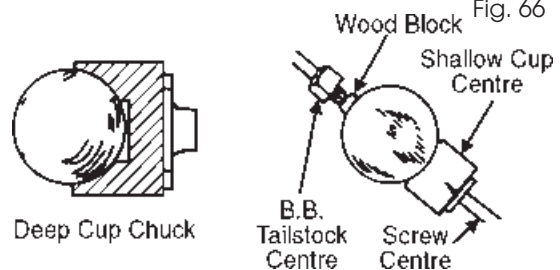

If the ball is mounted as a faceplate turning, almost the entire surface can be turned before it becomes necessary to rechuck it. Rechucking can be accomplished in a deep cut chuck, which will hold the finished portion of the ball in a tight press fit. Another method of rechucking is to use a shallow cup chuck which will not support the ball alone, but must be used in conjunction with the tailstock. When using the shallow chuck, a wood block is fitted to the tailstock so that the ball can revolve upon it. This block should be lubricated with beeswax or grease. In using the shallow chuck method, the

ball is constantly shifted, never more than 1/8 turn and always with a definite pattern. Since turning between centres makes the work a perfect sphere across the grain, the ball must be mounted in the chuck so that the first scraping cuts will round it up in the opposite direction .

6. TURNED BOXES

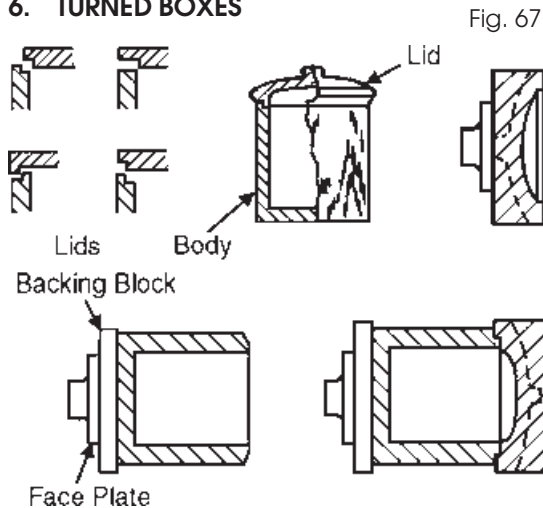


Fig. 67

Turned boxes involve deep recessing together with a special system of working the lid and body of the box together as one unit. The inside of the lid is turned first. Next, the inside of the body is turned. A careful check must be made when turning the body portion so that the lid will be a tight press fit. The lid is then pressed on to the body and the outer circumference and face of the lid, together with the outer circumference of the body, are turned all at one time. This insures accurate matching of the two pieces. After the work is complete, the tight fit of the lid can be relieved by sanding the lip of the body.

7. SEGMENTED TURNINGS

Segmented turnings and boxes can be extremely attractive and this method of preparing wood stock is more economical than the use of a large stock piece.

For some types of work, segmenting is the only practical method because a block (if obtainable), would be so large that it would be very likely to warp.

The bowl illustrated in fig. 68 requires 12 segment pieces for the sides. Bowls can be worked with


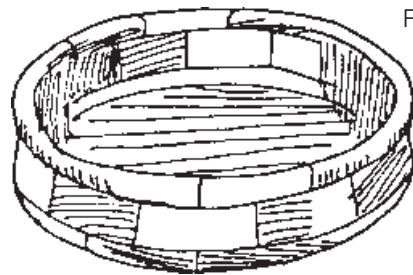


Fig. 68

6 or 8 pieces if desired.

To make the 12-piece bowl, a board about 22x76x760mm, is cut into pieces about 65mm long, the saw blade being tilted 15° and the board being turned alternatively face up and face down to make the successive cuts. These 12 pieces glued together and clamped by wrapping the assembly with wire. When dry the rim thus formed is glued to a temporary circular

Fig. 69

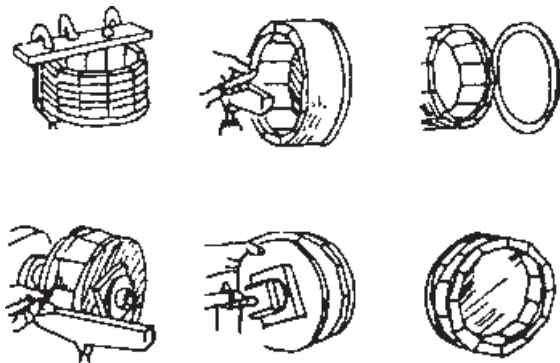

backing which is mounted on the large faceplate.

A recess of the largest possible diameter, and about 22mm deep, is turned in the open end of the rim. The rim is removed from the lathe, and stock for the bottom is mounted in its place on a second faceplate. This is turned to size and a rim about 3mm deep is turned to exactly fit the recess prepared in the rim. The rim is then fitted over the bottom and glued, making a drum shape with a faceplate at each end. This drum is cut completely in two, at a point about 22mm above the bottom, completing the cut with a hand saw. Both parts of the cut surface are faced off square and smooth, then reglued together, breaking the joints exactly half and half. The cutting and regluing process is repeated with a section about 32mm wide. After this, the temporary backing block is cut off, leaving the bowl as shown in the final illustration. From this point on the work is simply a matter of turning down the bowl to any desired shape.

TURNING PLASTICS

1. TYPES OF PLASTICS

There are two general groups of plastics. The first includes all phenol plastics moulded under heat and pressure. Bakelite and Formica are examples. In the second are all catalyst setting plastics of various bases sold under such trade names as Lucite, Catalin, Cast Bakelite, Marblette, Tenite and Trafford. Those in the second group are most generally used for craftwork. They are easy to turn, being a little harder than wood but much softer than any of the soft metals.

2. MOUNTING THE WORK

The most useful mounting device is the 4-jaw (metal lathe) chuck. When this is not available, cylinders can be mounted on a slightly tapered wooden mandrel. Rods can be mounted between centres, using either the wood mounting centres or metal mounting arrangements. When the spur centre is used, slots should be sawed across the work.

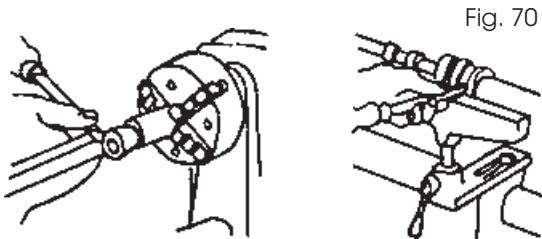


Fig. 70

3. USE OF WOOD TURNING CHISELS

Standard wood turning chisels are excellent for turning plastics by means of scraping methods. The tool rest should be slightly below centre and the chisel handle should be held a little higher than the cutting edge to give a negative rake. Scraping tools should be kept to a minimum. A large contact area, such as the full edge of the spear-point chisel, will cause chatter and probable chipping.

Properly worked, the chip comes off in a continuous ribbon. In cold weather, plastic may become brittle and should be tempered in warm water for about ten minutes before turning.

4. USE OF FORMED TOOLS FOR PRODUCTION BEADING AND SIMILAR OPERATIONS

When a number of identical pieces are to be

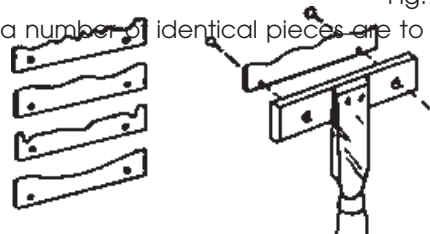


Fig.71

produced, all having a distinctive surface pattern, preformed tools will speed the work and assure uniformity. Patterns like those illustrated can be created by grinding thin gauge aluminium strips. A holder, like the one shown, can then be used to support any one of your prepared strips and guide it against the workpiece.

5. TURNING BALLS

Plastic balls are rough turned in the usual manner

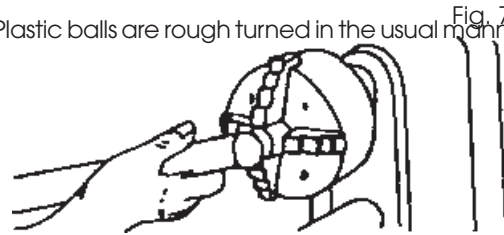


Fig. 72

and then brought to perfect roundness by using a tube tool. The tube should be slightly less in diameter than the finished size of the ball. It can be brass or steel, ground square across the end. The tool is used with or without a rest, and is worked by swinging it from side to side.

6. POLISHING PLASTICS

Start with sanding. First use 150-grit dry paper to remove tool marks, then finish off with 150-grit and 400-grit papers, in succession, used wet. Press lightly to avoid overheating and marring the work. Buffing gives the final polish, using the polishing compounds commonly supplied for this purpose. Do not press too hard or hold wheel at one spot too long, keep moving around, otherwise the plastic might become heat marked.

SANDING, BUFFING AND POLISHING

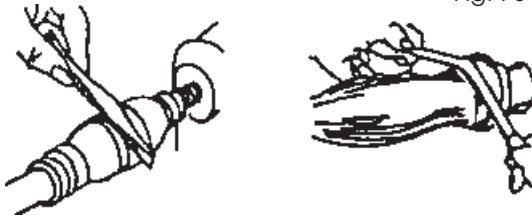


Fig. 73

The application of the sandpaper strip is shown in fig. 74. Care must be exercised in order to prevent dubbing the corners of beads, shoulders etc. It is good practice to finish sanding with the work in reverse rotation. This is particularly true when sanding basswood, white pine and mahogany. These woods are hard to sand clean since sanding packs the surface fuzz down to the wood. Sanding very lightly, and not too long with the lathe reversed, will lift the fibres and cut them off cleanly.

1. USING THE LATHE TO SAND TURNINGS

Turnings should be sanded with the lathe running in second lowest speed. A large sheet of sandpaper is useful for smoothing cylinders. All other sanding operations are done with a narrow strip of abrasive paper. The best finishing grit is 3/0 for soft wood, 4/0 for hard woods. Worn 2/0 paper is often used, and is the equivalent of 3/0 or 4/0 new paper.

2. USE OF SANDING DISCS

A fully adjustable sanding table adds to the scope and convenience of sanding operations. Sanding is always done on the down travel side of the wheel working on the other side would kick the work upwards. Either second or third speed can be used.

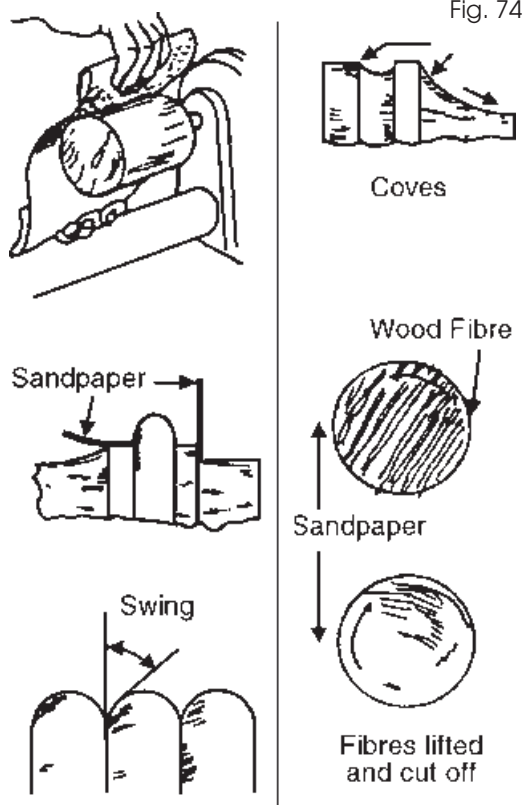


Fig. 74

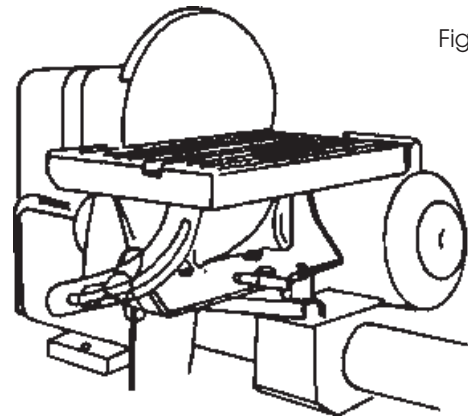


Fig. 75


The sanding disc is a metal plate with a threaded shank which fits the end of the lathe spindle. Abrasive paper is glued to the machined surface of the plate by means of a quick drying cement supplied for this purpose. Abrasive discs can be purchased or cut from the standard sizes of abrasive paper.

3. USE OF SANDING DRUMS

Standard sanding drums are usually rubber cylinders which can be expanded to hold an abrasive sleeve in place. Similar cylinders turned on the lathe and covered with abrasive paper

glued or tacked in place, do satisfactory work. These have the advantage that special sizes, tapers etc., can be made.

The drum is used mainly for sanding the edges

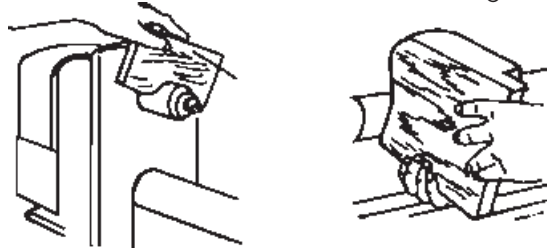

of curved work. The squareness of the edge of the work can be best retained by using a simple form of vertical fence as shown. The standard sanding drums are commonly made with a threaded hole to fit the Lathe Drive Spindle. To guard against loosening of the taper shank while the drum is in operation, it is advisable to support the free end, using either a ball bearing or plain 60° centre in the tailstock.

Quick acting chucks can be very useful for sanding operations on duplicate production parts. The chuck is made slightly oversized, and a piece of rubber hose (for small parts) is inserted in the recess to grip the workpieces. Workpieces can be changed without stopping the lathe.

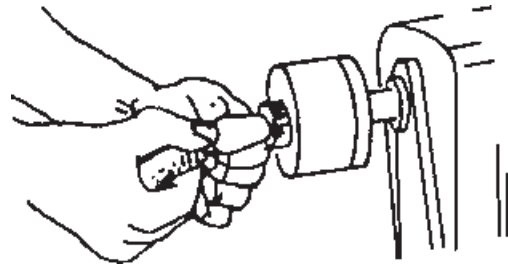


Fig.77

4. USE OF WOOD CHUCKS FOR SANDING

MAINTENANCE

WARNING : FOR YOUR OWN SAFETY, TURN THE SWITCH 'OFF' AND REMOVE THE PLUG FROM THE ELECTRICAL SOCKET BEFORE MAINTAINING OR LUBRICATING YOUR LATHE.

Frequently blow out any dust that may accumulate inside the motor.

A coat of car-type wax applied to the bed will help to keep the surfaces clean and allow the tool rest and tailstock to move freely.

If the mains lead is worn, cut or damaged in any way, have it replaced immediately.

LUBRICATION

All the BALL BEARINGS are packed with grease at the factory and require no further lubrication. Periodically lubricate the the tailstock spindle with either SAE20 or SAE30 engine oil.

OPTIONAL ACCESSORIES

A full range of optional accessories (detailed below) are available from your local dealer.

<u>Accessory</u>	<u>Part No</u>
Cup Turning Chuck	6500641
Screw Chuck	6500642
1/2" Capacity (13mm), MT Tailstock Chuck	6500643
4 Jaw Independent Lathe Chuck	6500645
Bowl Turning Rest	6500646
6" Face Plat (Right Hand)	6500646
6" Face Plate(Left Hand)	6500648
8 Piece Chisel Set	6500649

PARTS & SERVICE CONTACTS

For Spare Parts and Service, please contact your nearest dealer,
or CLARKE International, on one of the following numbers.

PARTS & SERVICE TEL: 020 8988 7400

PARTS & SERVICE FAX: 020 8558 3622

or e-mail as follows:

PARTS: Parts@clarkeinternational.com

SERVICE: Service@clarkeinternational.com

PARTS LIST

** See your CLARKE dealer

No. Description	Part No.	No. Description	Part No.
1 Pulley, Motor	**	37 Plunger	SD1237
2 Screw, Hex Socket	SD1202	38 Pin	SD1238
3 Motor	SD1203	39 Spring	SD1239
4 Screw, Hex HD	SD1204	40 Housing, Plunger	SD1240
5 Washer, 1/4 Plain Flat	SD1205	41 Spindle, Headstock	SD1241
6 Lockwasher, 1/4 External Tooth	SD1206	42 Nut - 3/4-16 Hex	SD1242
7 Nut,	SD1207	43 Centre = 1MT Spur	SD1243
8 Bolt, 5/16x1 Hex HD	SD1208	45 Belt, "Vee" 1/2x37	SD1245
9 Bracket - Motor Mount	SD1209	46 Tube, Headstock End Bed	SD1246
10 Bracket - Hinge	SD1210	47 Keyway, Headstock End Bed	SD1247
11 Pin - Hinge	SD1211	50 Tube, Tailstock End Bed	SD1250
12 Ring	SD1212	51 Keyway, Tailstock End Bed	SD1251
14 Nut 3/8	SD1214	52 Screw	SD1252
15 Cover - Belt Guard	SD1215	53 Support, Tool Rest	SD1253
16 Cap, Spindle End	SD1216	54 Washer, Tool Rest Clamping	SD1254
17 Rest, 6 in tool	SD1217	55 Handle Wrench	SD1255
18 Knob, Cover Lock	SD1218	56 Bolt - 3/8 - 16 x 1/2 Hex HD	SD1256
19 Ring, Snap	SD1219	57 Holder, Tool Rest	SD1257
20 Clamp, Wire	SD1220	58 Rest, 12" Tool	SD1258
21 Cord, Power W/Plug	SD1221	59 Brass slug	SD1259
22 Box, Electrical Terminal	SD1222	60 Nut, Stud	SD1260
23 Switch, ON-OFF Power	SD1223	61 Lever Assembly, Lock	SD1261
24 Name Plate	SD1224	62 Bushing	SD1262
25 Screw, Self Tapping	SD1225	63 Grip	SD1263
26 Nut 5/16	SD1226	64 Centre = 1 MT BB Cup	SD1264
27 Plate, Belt Guard	SD1227	65 Spindle, Tailstock	SD1265
28 Pulley, Spindle Drive	**	66 Screw,	SD1266
29 Screw, 3/16-24x1/4	SD1229	67 Handwheel	SD1267
30 Lockwasher - 3/16	SD1230	68 Tailstock	SD1268
31 Collar	SD1231	69 Foot	SD1269
32 Bearing, Ball	SD1232	70 Bolt - Bed Clamping	SD1270
33 Ring, Retaining 1 5/8	SD1233	71 Bolt - 3/8-16x11/4	SD1271
34 Headstock	SD1234	73 Nut, 5/16	SD1273
35 Screw, Soc. HD Set 3/8-16x3/4	SD1235	74 Name Plate Mounted	SD1274
36 Bolt, 1 Hex HD 5/16x3/4	SD1236	75 Faceplate 4" RH.TH D	SD1275

PARTS DIAGRAM

